

AD-A198 368

MEMBRANE AND FLASHING CONDITION INDEXES FOR BUILT-UP
ROOFS VOLUME 2 INSPE (U) CONSTRUCTION ENGINEERING
RESEARCH LAB (ARMY) CHAMPAIGN IL M V SHAHIN ET AL
SEP 87 CERL-TR-M-87/13-VOL-2


1/2

UNCLASSIFIED

F/G 13/13

NL



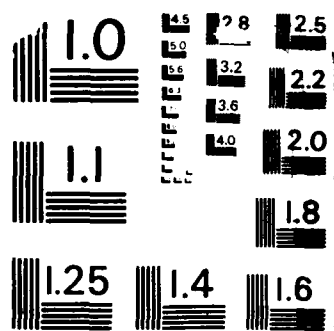

MICROCOPY RESOLUTION TEST CHART
NATIONAL BUREAU OF STANDARDS-1963-A

AD-A190 368



US Army Corps
of Engineers
Construction Engineering
Research Laboratory

USA-CERL TECHNICAL REPORT M-87/13, VOL. II
September 1987
Roofing Maintenance Management System

DTIC FILE COPY

2

Membrane and Flashing Condition Indexes for Built-Up Roofs Volume II: Inspection and Distress Manual

by
Mohamed Y. Shahin
David M. Bailey
Donald E. Brotherson

Because no systematic procedure exists to determine priorities and select repair strategies for low-slope roofs, the U.S. Army Construction Engineering Research Laboratory (USA-CERL) is developing a roof maintenance management system that will provide a practical decisionmaking procedure to identify cost-effective repairs.

As part of the system for built-up roofs, this volume presents the standardized information needed to conduct the visual inspection survey, including names, descriptions, severity levels, measurement criteria, causes, and photographs of membrane and flashing distresses. Procedures for distress density calculations are also provided. Roof inspectors can use this information to objectively determine the indexes that reflect the (1) ability of the membrane and flashing to perform their functions, (2) needed level of maintenance, and (3) waterproof integrity.

Volume I describes the development and verification of the indexes.

DTIC
ELECTE
S JAN 19 1988 D
E

Approved for public release; distribution is unlimited.

88 1 7 032

The contents of this report are not to be used for advertising, publication, or promotional purposes. Citation of trade names does not constitute an official indorsement or approval of the use of such commercial products. The findings of this report are not to be construed as an official Department of the Army position, unless so designated by other authorized documents.

*DESTROY THIS REPORT WHEN IT IS NO LONGER NEEDED
DO NOT RETURN IT TO THE ORIGINATOR*

Unclassified

SECURITY CLASSIFICATION OF THIS PAGE

ADA190368

REPORT DOCUMENTATION PAGE				Form Approved OMB No. 0704-0188 Exp. Date 10-31-1986	
1a REPORT SECURITY CLASSIFICATION Unclassified			1b RESTRICTIVE MARKINGS		
2a SECURITY CLASSIFICATION AUTHORITY			3 DISTRIBUTION AVAILABILITY OF REPORT Approved for public release; distribution is unlimited		
2b DECLASSIFICATION/DOWNGRADING SCHEDULE					
4 PERFORMING ORGANIZATION REPORT NUMBER(S) USA-CERL TR M-87/13, Vol. II			5 MONITORING ORGANIZATION REPORT NUMBER(S)		
5a NAME OF PERFORMING ORGANIZATION U.S. Army Construction Engr Research Laboratory		6b OFFICE SYMBOL (If applicable)		7a NAME OF MONITORING ORGANIZATION	
6c ADDRESS (City, State, and ZIP Code) P.O. Box 4005 Champaign IL 61820-1305			7b ADDRESS (City, State, and ZIP Code)		
3a NAME OF FUNDING/SPONSORING ORGANIZATION 1. Northern Division (cont'd)		3b OFFICE SYMBOL (If applicable)		9 PROCUREMENT INSTRUMENT IDENTIFICATION NUMBER FADs N62472-85P05008, N62472-85WR00151, N62472-85WR00132	
8c ADDRESS (City, State, and ZIP Code) 1. Philadelphia Naval Base Philadelphia PA 19112-5094 2. 20 Massachusetts Ave., N.W. (cont'd)		10 SOURCE OF FUNDING NUMBERS			
		PROGRAM ELEMENT NO 4A162731		PROJECT NO AT41	TASK NO C
				WORK UNIT ACCESSION NO 044	
11 TITLE (Include Security Classification) Membrane and Flashing Condition Indexes for Built-Up Roofs, Volume II: Inspection and Distress Manual					
12 PERSONAL AUTHOR(S) Shahin, Mohamed Y.; Bailey, David M.; Brotherson, Donald E.					
13a TYPE OF REPORT final		13b TIME COVERED FROM _____ TO _____		14 DATE OF REPORT (Year, Month, Day) 1987, September	
15 PAGE COUNT 98					
16 SUPPLEMENTARY NOTES Copies are available from the National Technical Information Service Springfield, VA 22161					
17 COSATI CODES			18 SUBJECT TERMS (Continue on reverse if necessary and identify by block number)		
FIELD	GROUP	SUB-GROUP	management information system		
13	13		mainframe		
			built-up roofs		
19 ABSTRACT (Continue on reverse if necessary and identify by block number)					
<p>Because no systematic procedure exists to determine priorities and select repair strategies for low-slope roofs, the U.S. Army Construction Engineering Research Laboratory (USA-CERL) is developing a roof maintenance management system that will provide a practical decisionmaking procedure to identify cost-effective repairs.</p> <p>As part of the system for built-up roofs, this volume presents the standardized information needed to conduct the visual inspection survey, including names, descriptions, severity levels, measurement criteria, causes and photographs of membrane and flashing distresses. Procedures for distress density calculations are also provided. Roof inspectors can use this information to objectively determine the indexes that reflect the (1) ability of the membrane and flashing to perform their functions, (2) needed level of maintenance, and (3) waterproof integrity.</p> <p>Volume I describes the development and verification of the indexes.</p>					
20 DISTRIBUTION AVAILABILITY OF ABSTRACT <input type="checkbox"/> UNCLASSIFIED/UNLIMITED <input checked="" type="checkbox"/> SAME AS RPT <input type="checkbox"/> DTIC USERS			21 ABSTRACT SECURITY CLASSIFICATION Unclassified		
22 NAME OF RESPONSIBLE INDIVIDUAL Gloria Wienke			23 TELEPHONE (Include Area Code) (217) 352-6511 ext 353		
			24 OFFICE SYMBOL CECER-INT-E		

Unclassified

Block 8a. (cont'd)

Naval Facilities Engineering Command (NORTHNAVFACENGCOM)

2. OCE

Block 8c. (cont'd)

Washington, DC 20314-1000

Unclassified

FOREWORD

This project was funded by the Northern Division Naval Facilities Engineering Command (NORTHNAVFACENGCOM), U.S. Naval Base, Philadelphia, PA, under Funding Authorization Documents N62472-85P05008, N62472-85WR00151, and N62472-85WR00132. The U.S. Navy Technical Monitor was Mr. Tom Wallace. Funds were also provided by the Assistant Chief of Engineers, Office of Chief of Engineers (OCE), under Project 4A162731AT41, "Military Facilities Engineer Technology"; Task C, "Operations/Management/Repair"; Work Unit 044, "Roofing Maintenance Management System." The U.S. Army Technical Monitor was Mr. Chester Kirk, DAEN-ZCF-B.

The work was performed by the Engineering and Materials (EM) Division, U.S. Army Construction Engineering Research Laboratory (USA-CERL) in cooperation with the U.S. Army Cold Regions Research and Engineering Laboratory (CRREL) and the U.S. Army Facilities Engineering Support Agency (FESA). Dr. R. Quattrone is Chief of USA-CERL-EM. The Technical Editor was Gloria J. Wienke, Information Management Office.

Mr. Donald Brotherson is a member of the Small Homes Council-Building Research Council, University of Illinois.

Special acknowledgement is due to contractors Mr. John Bradford and Mr. Dwight Jennings, who were key members of the development team and participated in all field testing and validation efforts. The assistance of the following individuals is acknowledged and appreciated: Mr. Robert Alumbaugh, Navy Civil Engineering Laboratory (NCEL); Mr. Mark de Ogburn, SOUTHNAVFACENGCOM; Mr. Dennis Firman, Air Force Engineering and Services Center (AFESC); Mr. Ed Humm, NCEL; Mr. Al Knehans, FESA; Mr. Myer Rosenfield, USA-CERL; and Mr. Wayne Tobiasson, CRREL.

COL Norman C. Hintz is Commander and Director of USA-CERL, and Dr. L. R. Shaffer is Technical Director.

Accession For	
NTIS GRA&I	<input checked="" type="checkbox"/>
DTIC TAB	<input type="checkbox"/>
Unannounced	<input type="checkbox"/>
Justification	
By _____	
Distribution/	
Availability Codes	
Dist	Avail and/or Special
A-1	



Original contains color photos: All DTIC reproductions will be in black and white.

CONTENTS

	Page
DD FORM 1473	1
FOREWORD	3
LIST OF FIGURES	5
1 INTRODUCTION	7
Background	7
Objective	7
Approach	7
Using the Manual	8
2 PROCEDURES FOR ROOF INSPECTION AND CALCULATION OF INDEXES	9
Introduction	9
Roof Sections	9
Roof Plans	9
Inspection Procedure	12
Inspection Guidelines	14
Calculating the Indexes	18
3 FLASHING DISTRESSES	23
Index	23
Base Flashing	24
Metal Cap Flashing	30
Embedded Edge Metal	36
Flashed Penetrations	41
Pitch Pans	46
Interior Drains and Roof Level Scuppers	50
4 MEMBRANE DISTRESSES	53
Index	53
Blisters	54
Ridges	57
Splits	60
Holes	62
Surface Deterioration	63
Slippage	68
Patching	70
Debris and Vegetation	73
Improper Equipment Supports	76
Ponding	80
APPENDIX A: Deduct Value Curves	83
APPENDIX B: Inspection and Rating Sheets	93
DISTRIBUTION	

LIST OF FIGURES

Number		Page
1	Membrane and Flashing Condition Indexes (MCI and FCI) and Ratings	8
2	Roof Inspection Worksheet	10
3	Legend to be Used on Roof Section Plans	11
4	Completed Roof Inspection Worksheet	13
5	Check Height of Base Flashing Above Deck	15
6	Check Base Flashing Height by Running Fingers Behind Counterflashing	15
7	Sweep Gravel Back From Embedded Edge Metal to Expose Joints	16
8	Tear in Stripping Felts Exposed by Sweeping Gravel Away at Joints	16
9	Roof Drain Clogged by Debris	17
10	Removing Debris Frees the Drain	17
11	Scupper Opening is too Small and Easily Clogged. Report in the "Remarks" Section of the Roof Inspection Worksheet.	19
12	Metal Curb Around Scuttle is Corroded and Needs Paint. Report in the "Remarks" Section.	19
13	Steps for Determining Roof Membrane Condition Rating	20
14	Roof Section Rating Form	21

**MEMBRANE AND FLASHING CONDITION
INDEXES FOR BUILT-UP ROOFS
VOLUME II: INSPECTION AND
DISTRESS MANUAL**

1 INTRODUCTION

Background

Each of the U.S. armed services branches has a very large inventory of low-slope roofs. Roof repairs and reconstruction work are steadily increasing as the roofs approach the end of their service lives, making it increasingly important to better manage maintenance funds. To ensure the optimum use of these funds, the U.S. Army Construction Engineering Research Laboratory (USA-CERL) is developing a roofing maintenance management system for low-slope roofs. This work is being performed with the coordination and assistance of the U.S. Army Cold Regions Research and Engineering Laboratory (CRREL) and the U.S. Army Facilities Engineering Support Agency (FESA).

The system will be developed initially for built-up roofs and will include other roofing systems in the future. The system will be based on a roof condition evaluation procedure which includes a visual inspection survey and nondestructive testing of the roof insulation. The visual inspection will provide a membrane condition index (MCI) and flashing condition index (FCI) which are numerical indicators that reflect the condition of each component in terms of its ability to perform its function, needed level of maintenance and repair, and waterproof integrity.

The two condition indexes are calculated based on the type, severity, and density of distress as determined from the visual roof inspection. To obtain repeatable and meaningful condition index values, distress identification and measurement must be standardized.

Objective

The objective of this work effort was to develop a roof condition index procedure for built-up roofs determined from a visual inspection. This volume provides roof inspectors with a standardized reference for distress identification for both the membrane and flashing. The distress information is to be used in conjunction with the procedures presented in Chapter 2 to determine the MCI and FCI.

Approach

The existing U.S. Air Force roof condition index (RCI) procedure¹ was modified to improve its accuracy, reduce field effort, and increase its usefulness. The modifications and improvements were field tested and revised based on results obtained at seven military installations located in different climates. Guidelines for performing roof inspections and procedures for computing the MCI and FCI were developed.

¹ *Built-Up Roof Management Programs*, Air Force Manual, AFM 91-36, 3 September 1980.

Using the Manual

Chapter 2 contains the inspection procedures. Distresses for the flashing and membrane are presented in Chapters 3 and 4, respectively. Names, descriptions, severity levels, photographs, measurement criteria, and causes are presented for each distress.

It is very important that the inspector be able to identify all distress types and their severity levels and specific defects. The inspector should study this manual and carry a copy for reference during the inspection.

The results of the roof inspection are to be used in conjunction with procedures in Chapter 2 to determine the MCI and FCI and their respective ratings (Figure 1). Deduct value curves are in Appendix A. A sample of the sheets to be used by the roof inspectors is provided in Appendix B.

It should be emphasized that inspectors must follow the distress descriptions in this manual to arrive at meaningful and consistent values for the condition indexes.

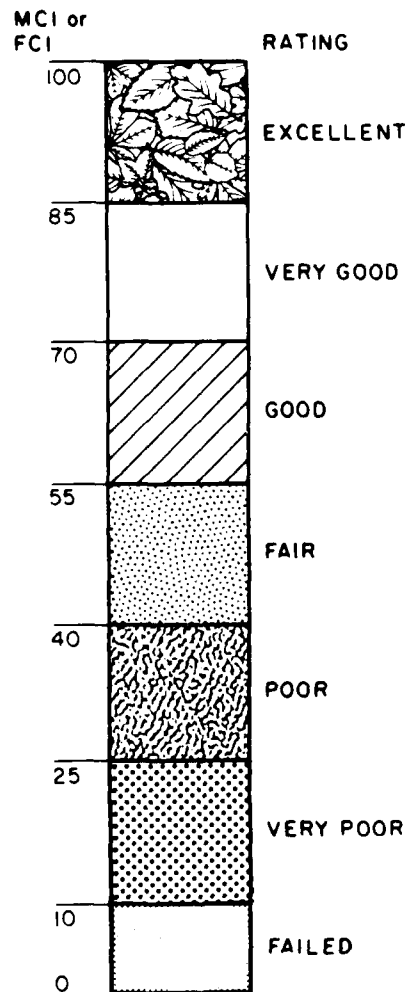


Figure 1. Membrane and Flashing Condition Indexes (MCI and FCI) and ratings.

2 PROCEDURES FOR ROOF INSPECTION AND CALCULATION OF INDEXES

Introduction

Determining the condition indexes requires measurement of all the existing roof membrane and flashing distresses. A thorough roof inspection must be made to determine the types, severity, specific defects, and amounts (density) of each distress present. This inspection must be carefully organized and planned to provide the necessary information for determining the membrane and flashing conditions.

This chapter presents the procedures for visually inspecting built-up roofs and computing the membrane and flashing condition indexes.

Roof Sections

Dividing a building's roof into sections and rating each separately provides a better evaluation of the overall roof condition because (1) a roof section that is in poor condition would not detract from the condition index of a good roof section on the same building, and (2) a condition index indicating that replacement of the section is necessary would not signal replacement of the roof on the entire building.

A section is generally delineated by:

- expansion joints or area dividers
- different roof elevations
- areas of major repair or replacement
- areas that were built at different times
- areas having different roof systems, different amounts of roof traffic and/or rooftop equipment, or radically different occupancies below the roof
- areas having particularly sensitive occupancies below, such as computer centers, operating rooms or command centers.

Some judgment is necessary in cases where the roof is segmented into very small areas or if there are no identifiable delineations on large roofs. Small sections may be combined where practical. However, if areas have distinct differences in characteristics such as different structural systems, roof systems, or environments below the roof structure (i.e., canopies, freezers, unheated warehouses), they should be treated as individual sections. Large areas without delineations can be divided into sections with areas of 25,000 to 40,000 sq ft.

Roof Plans

Each roof section should have a roof plan which is drawn to a scale (approximately 1" = 30') that fits on the Roof Inspection Worksheet (Figure 2). The plan should show all physical roof features, including perimeter conditions (roof edge, expansion joint, penthouse, etc.), rooftop equipment, projections through the roof, roof drains, walkways, sign supports, piping, etc. Standard symbols should be used to identify these items whenever possible (Figure 3).

ROOF INSPECTION WORKSHEET		INSTALLATION <u>FT. JONES</u>	
BUILDING <u>68</u>	PER. FLASHING <u>527</u> FT	DATE _____	
SECTION <u>G</u>	CURB FLASHING <u>36</u> FT	NAME _____	

DISTRESS TYPE	IDENT NO	DISTRESS	SEVERITY	DEFECT	QUANTITY
BF - BASE FLASH					
MC - METAL CAP					
EM - EMBEDDED MET					
FP - FLASHED PEN					
PP - PITCH PANS					
DR - DRAIN & SCUPPER					
BL - BLISTERS					
RG - RIDGES					
SP - SPLITS					
HL - HOLES					
SR - SURF DET					
SL - SLIPPAGE					
PA - PATCHING					
DV - DEBRIS & VEG					
EQ - EQ SUPPORTS					
PD - PONDING					


SCALE: 1" = 30'

NORTH

Figure 2. Roof inspection worksheet. (This form has been reduced in size.)



 H = HATCH
E = EQUIPMENT
P = PENTHOUSE
S = SKYLIGHT
SC = SOLAR COLLECTOR
T = TRANSFORMER
V = VENTILATOR



ANTENNA



CORE SAMPLE



VENT PIPE



 
DRAIN OR DOWNSPOUT



LADDER



SCUPPER



CHIMNEY OR FLUE



PITCH PAN



FLASHED PIPE



LIGHTNING ROD



ROOF EDGE



PARAPET WALL OR ADJACENT BLDG



EXPANSION JOINT OR ROOF DIVIDER

Figure 3. Legend to be used on roof section plans.

Inspection Procedure

Survey Team

The roof inspection should be performed by a team of at least two people: an inspector and a recorder. The inspector surveys the roof, identifying distresses and determining severity levels, specific defects, and quantities. The recorder records the data on the Roof Inspection Worksheet and assists in measuring distress quantities when required. The recorder must also serve as the safety observer for the team.

Supplies

The following supplies are required for performing the inspection:

- Inspection and Distress Manual
- Pencil and clipboard
- Roof Inspection Worksheets
- Small 3 in. pointing trowel (to scrape gravel)
- Can of spray paint
- Stiff bristle whisk broom
- Pocket knife
- 12-ft and 100-ft measuring tapes
- Large plastic bag (to collect rooftop debris)
- Satchel (for carrying tools and materials)

Survey Preparation

The survey team should complete the general information section at the top of the Roof Inspection Worksheet (Figure 2) and gain access to the roof section. Contact the building superintendent or custodian for assistance. Develop or verify the roof plan before the survey begins. All penetrations, projections, and rooftop equipment should be shown and located correctly. Check plan dimensions against actual field dimensions.

Distress Survey

Perform the distress survey using the following steps:

1. Inspect the perimeter flashing. Establish a starting point at one corner of the roof section. Walk the entire perimeter, examining the base flashing, embedded edge metal flashing, and metal cap flashing.

2. Identify all distresses and specific defects according to the distress manual. Mark each medium and high severity distress with spray paint.* Enter each identified distress by type, severity level, specific defect (specific defects are listed numerically for each distress [see Chapters 3 and 4]), and quantity on the Roof Inspection Worksheet. Note the location of each distress on the roof plan using an identification number (Figure 4). Determine the distress quantities using the measurement criteria described in Chapters 3 and 4.

3. After inspecting the perimeter, work across the roof area inspecting all other flashings: curbed penetrations, flashed penetrations, pitch pans, drains, etc. Record data as in step 2.

*To be used by maintenance personnel for locating necessary work.

Figure 4. Completed roof inspection worksheet. (This form has been reduced in size.)

4. Inspect the roof membrane. Establish a starting point at one corner of the roof section. Using 10- to 15-ft wide strips, sweep back and forth across the roof section surveying the entire membrane. Record data as in step 2.

5. Complete the "Remarks" section on the back of the Roof Inspection Worksheet.

It is imperative to use the distress definitions listed in this distress manual when performing roof inspections. If these definitions are not followed, accurate indexes cannot be determined. Use a second Roof Inspection Worksheet if the first one becomes filled.

Inspection Guidelines

The guidelines below should be followed when performing the visual inspection and distress survey.

Base Flashing

Measure height of top termination of base flashing above the roof surface (Figure 5). To establish the height, run fingers up behind the counterflashing. If the base flashing height cannot be determined, assume it is adequate (Figure 6).

Metal Cap Flashing

Check for looseness of metal cap flashing by attempting to lift it by hand at several locations.

Embedded Edge Metal

Determine the total number of joints by dividing the total length of embedded edge metal flashing by the length of the edge metal sections (normally 10 ft). Inspect every fourth joint for splits in the stripping felts, removing any loose gravel or dirt from the joint using the small whisk broom and pointing trowel (Figure 7). Determine the number of inspected joints that are high severity (have splits in the stripping felts [Figure 8]) and multiply by 4 to get the total number of high severity joints (one joint equals 1 ft). All other joints are considered medium severity. Multiply the number of inspected joints not counted as high severity by 4 to obtain the total number of medium severity joints. Check that the embedded edge metal flashing is secure by attempting to lift the outside edge.

Flashed Penetrations

Check the height of the flashing sleeve above the roof surface. Use a whisk broom and trowel to examine stripping felts.

Interior Drains and Roof Level Scuppers

Check all drains and scuppers and remove debris whenever possible (Figures 9 and 10). When inspecting drains, make sure the clamping ring is tight. Stripping felts around scuppers should be inspected for holes at corners.



Figure 5. Check height of base flashing above deck.



Figure 6. Check base flashing height by running fingers behind counterflashing.



Figure 7. Sweep gravel back from embedded edge metal to expose joints.



Figure 8. Tear in stripping felts exposed by sweeping gravel away at joints.



Figure 9. Roof drain clogged by debris.



Figure 10. Removing debris frees the drain.

Membrane

Membrane inspection requires surveying the entire roof area. However, when large areas of a particular distress and severity level are present (especially on large roofs), the representative sampling technique can be used. Select a portion of the roof (approximately 1000 sq ft) which appears to be typical of the entire roof area. Measure the quantity of distress in the sample area and by extrapolation, calculate the quantity for the entire roof area. An area that differs greatly from the majority of the roof should be surveyed separately.

General

The following is a list of general guidelines for the roof inspection:

- Be careful not to damage the roof. Do not step on blisters, kick base flashing or step on edge flashing.
- Note existing problems that are not included in the lists of flashing and membrane distresses in the "remarks" section on the back of the worksheet. Figures 11 and 12 show examples of these problems. Walk the outside of the building and look for water stains, efflorescence, missing mortar, spalled brick, and gutter and drainage problems.
- Walk the interior of the building and examine the ceiling below the roof deck for water marks. Note rusting or other signs of water penetration or leaks in the "remarks" section on the back of the worksheet.
- If there is snow or a large area of ponding on the roof, postpone the inspection until the roof is clear.
- Wherever possible, use a measuring tape to determine roofing distress quantities. Estimating is acceptable when necessary; however, the rating accuracy will be only as good as the estimating accuracy. Pacing to find lengths, or some other quantifying estimating method, is preferable to an "eyeball" estimate.
- If more than one severity level of a distress exists in a localized area, count the entire area at the highest severity level.

Calculating the Indexes

Once the condition survey is completed, determine the FCI and MCI for the roof section. Calculating the condition indexes is a simple procedure which involves five steps (Figure 13).

1. For each combination of distress and severity level, transfer the quantities from the Roof Inspection Worksheet to the Roof Section Rating Form (Figure 14).
2. Total the quantities for each combination, calculate their corresponding densities, and determine the deduct values from the deduct value curves (Appendix A) for each distress type and severity.



Figure 11. Scupper opening is too small and easily clogged. Report in the "Remarks" section on the back of the Roof Inspection Worksheet.




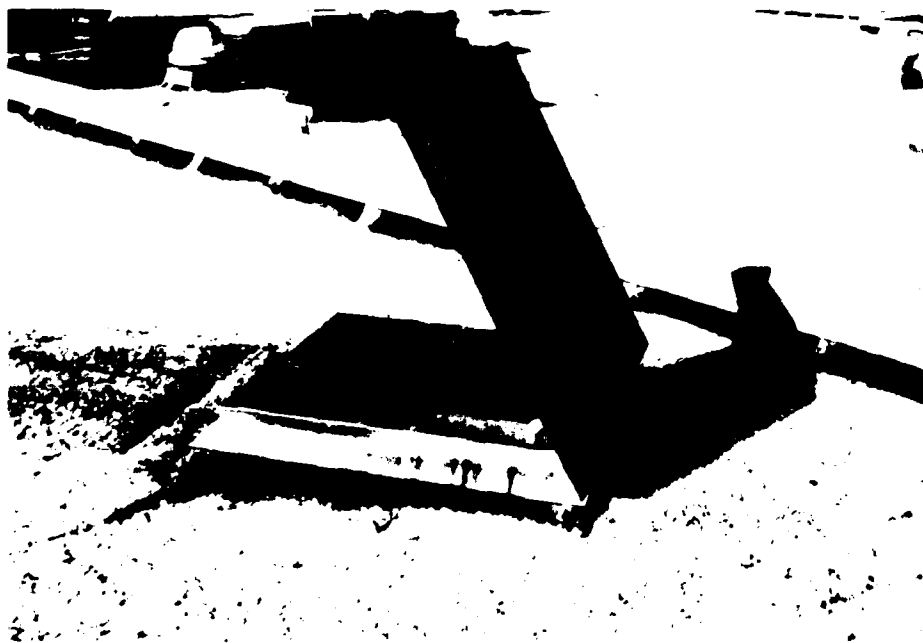


Figure 12. Metal curb around scuttle is corroded and needs paint. Report in the "Remarks" section.

STEP 1 INSPECT ROOF DETERMINE DISTRESS TYPES AND SEVERITY LEVELS
DETERMINE QUANTITIES AND CALCULATE DENSITIES

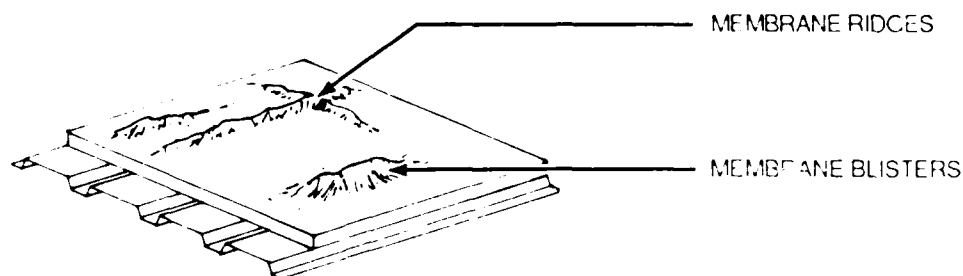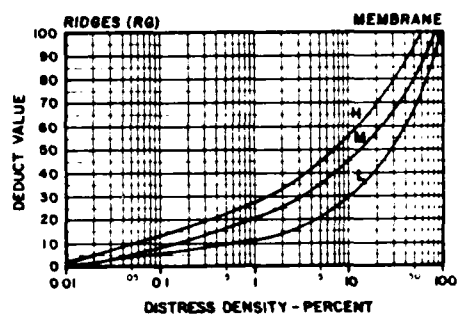


STEP 2 DETERMINE DEDUCT VALUES.

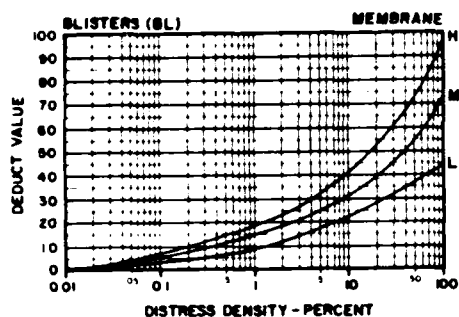

STEP 5. DETERMINE MEMBRANE
CONDITION RATING.

STEP 3. COMPUTE CORRECTED DEDUCT VALUE.

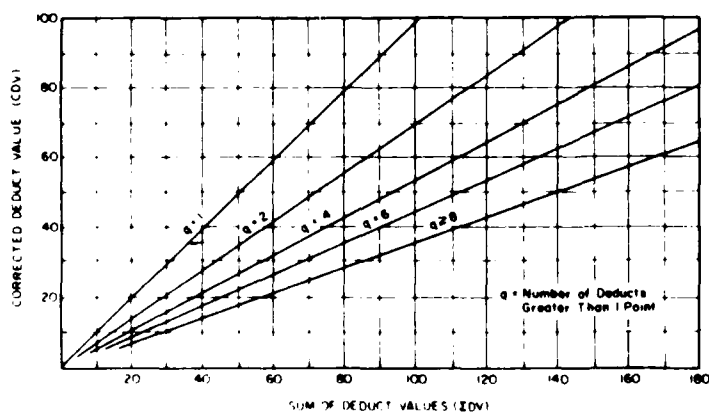

STEP 4 COMPUTE MEMBRANE CONDITION INDEX (MCI) = 100 - CDV

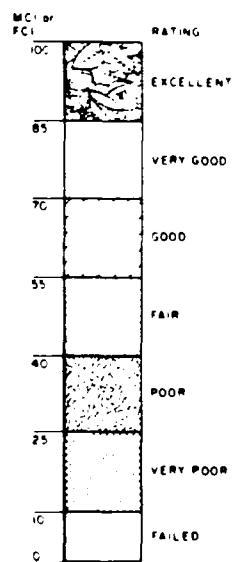


Figure 13. Steps for determining roof membrane condition rating.

Figure 14. Roof section rating form. (This form has been reduced in size.)

3. For each component (flashing and membrane), list the individual deduct values in descending order and compute the sum of the deduct values (ΣDV) and q (# of DV's > 1) as shown below. Determine the corresponding corrected deduct values (CDVs) from the Corrected Deduct Value Curves (Appendix A). The CDV of maximum value should be used to compute the condition index.

Flashing (distress data from Figure 14)

<u>DV</u>	<u>ΣDV</u>	<u>q</u>	<u>CDV</u>
21	21	1	21
17	38	2	24
13	51	3	28
13	64	4	32
11	75	5	33
9	84	6	33
2	86	7	32
1	87	7	31

$$\text{Maximum } CDV_{\text{flashing}} = 33$$

Membrane (distress data from Figure 14)

<u>DV</u>	<u>ΣDV</u>	<u>q</u>	<u>CDV</u>
65	65	1	65
14	79	2	55
7	86	3	53
5	91	4	48
3	94	5	47
3	97	6	43
3	100	7	40
2	102	8	37
2	104	9	38
2	106	10	38

$$\text{Maximum } CDV_{\text{membrane}} = 65$$

4. Compute the condition indexes using the following equations:

$$FCI = 100 - \text{Max. } CDV_{\text{flashing}} \quad [\text{Eq 1}]$$

$$MCI = 100 - \text{Max. } CDV_{\text{membrane}} \quad [\text{Eq 2}]$$

5. Determine the condition ratings from Figure 1.

3 FLASHING DISTRESSES

Index

<u>Distress</u>	<u>Page</u>
Base Flashing	24
Metal Cap Flashing	30
Embedded Edge Metal	36
Flashed Penetrations	41
Pitch Pans	46
Interior Drains and Roof Level Scuppers	50

BASE FLASHING

Description: Base flashing is one or more plies of material which extend from the roof surface up onto a vertical or inclined surface providing a watertight termination of the membrane.

Severity Levels:

Low: Any of the following conditions:

1. Loss of surfacing on mineral-surfaced sheets or other poor appearance (including patching) but no apparent deterioration of felts.
2. Top of base flashing is less than 6 in. above the roof surface.
3. Flashing has permanent repairs.



Medium: Any of the following conditions:

1. Slippage, wrinkling, blistering, or pulling of base flashing material.
2. Loss of surfacing with some deterioration of felts but no holes, splits, or tears.
3. Grease, solvent, or oil drippings on the base flashing but no deterioration of felts.
4. Flashing has temporary repairs.

High: Any of the following conditions:

1. Holes, splits, or tears in flashing caused by deterioration or physical damage
2. Exposed gaps at the top of the base flashing which are not covered by counter-flashing or open side laps in the flashing which allow water to channel behind them.
3. Grease, solvent, or oil drippings on the base flashing with deterioration of the felts.

Measurement: Measure lineal feet of base flashing having the above conditions. Holes, open side laps, and seams count as 1 ft each. If an area of the base flashing is at medium severity and holes are closer than 6 in., count that entire length of distressed base flashing as high severity.

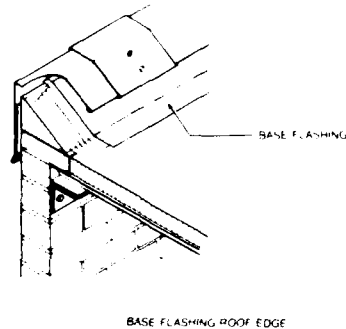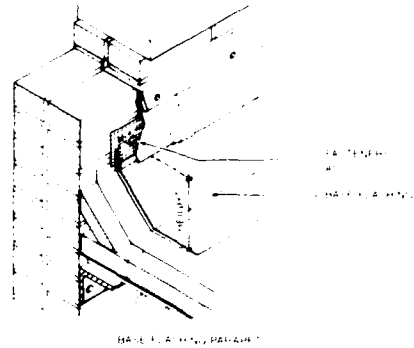

Base Flashing (BF)

Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = length of base flashing defects (ft)


B = total length of flashed perimeter of roof section being rated (including flashings for penthouses, courtyards, and curbed projections)

Note: The problem density is calculated for each existing severity level.


Causes:

1. Flashing splits or tears can result from mechanical damage, material shrinkage, unattached membrane pulling the flashing, or differential movement between the wall and the deck.
2. Delamination and sliding result from weak or no attachment between the flashing plies or between the flashing and the substrate. This can result from any of the following conditions:
 - When first installed, the flashing piles were not firmly pressed into the bitumen to form a solid, continuous laminate.
 - No primer was used on the wall.
 - The wrong bitumen was used to attach the flashing plies to the wall.
 - The flashing cement was improper or of poor quality.
 - The hot-mopped bitumen was allowed to cool before the flashing plies were applied.
 - Fasteners were improper type or too few to hold flashing to substrate.


Base Flashing (BF)

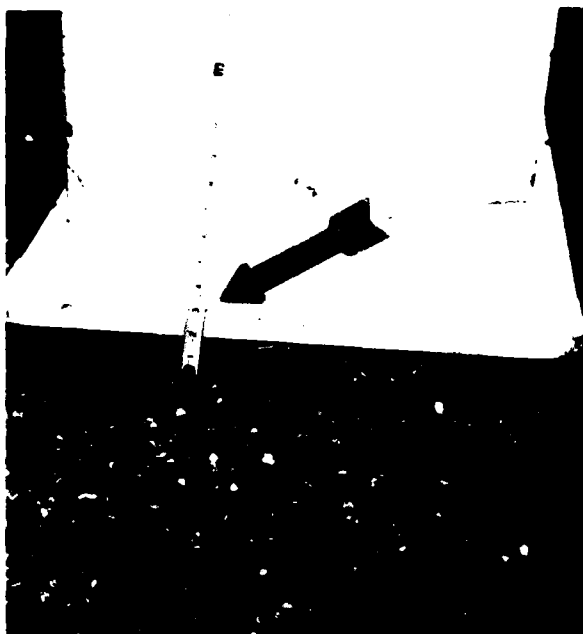

BF1 Base Flashing
 <Low Severity>
 Curb is not high enough--
 6 in. minimum

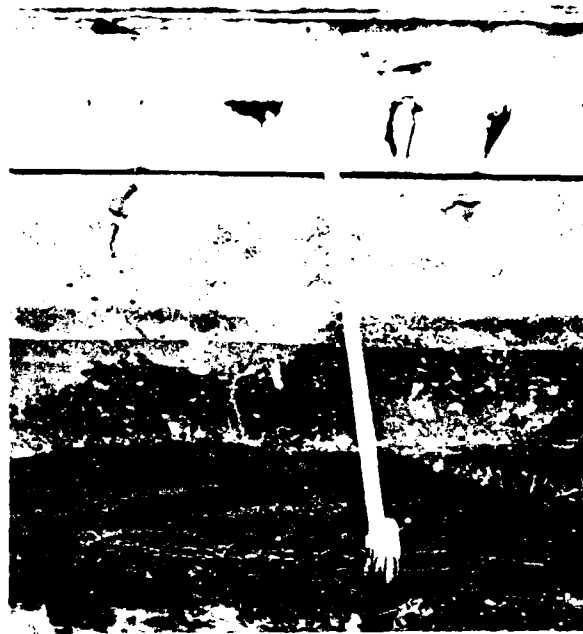

BF2 Base Flashing
 <Low Severity>
 Surface looks poor but there are
 no areas that are worn through

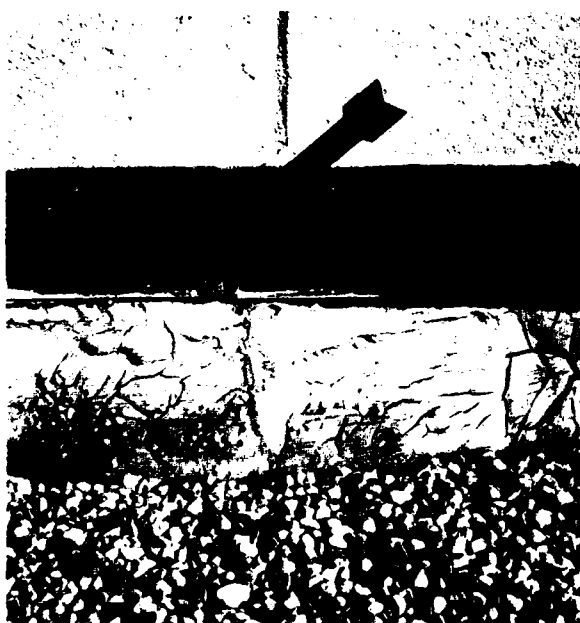

BF3 Base Flashing
 <Low Severity>
 Poor appearance of coating but coating
 is not worn through. Also, counter-
 flashing is displaced <High Severity>



BF4 Base Flashing
 <Low Severity>
 Mineral surfacing is worn but
 surface is still intact


Base Flashing (BF)




BF5 Base Flashing
<Medium Severity>
Surfacing is worn but hole is not
all the way through the flashing



BF6 Base Flashing
<Medium Severity>
Base flashing is pulled and not
firmly bonded to the curb

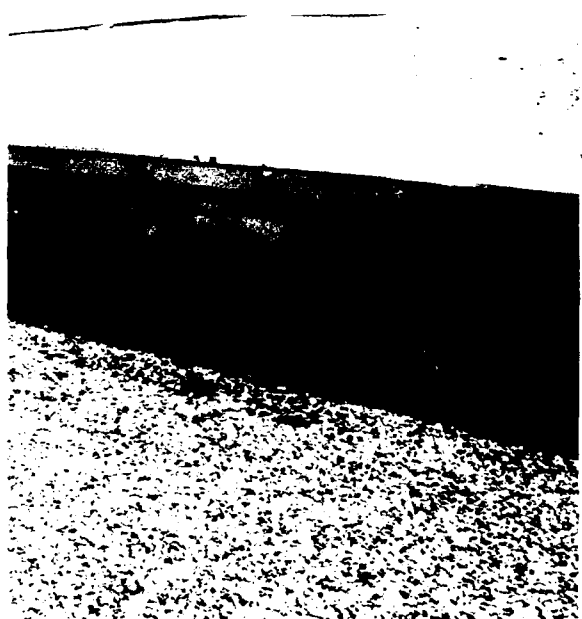

BF7 Base Flashing
<Medium Severity>
Flashing material has sagged

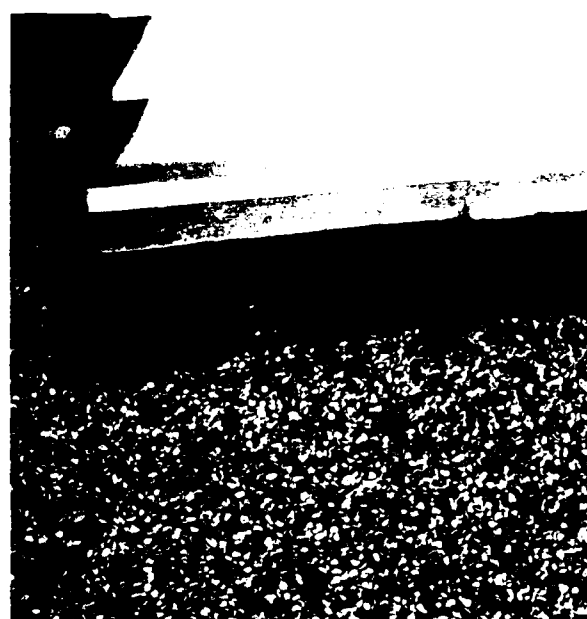

BF8 Base Flashing
<High Severity>
Deteriorated flashing material;
there are holes through all plies
of the flashing


Base Flashing (RD)



BF9 Base Flashing
<High Severity>
There is an open seam and the
material has sagged



BF10 Base Flashing
<High Severity>
There is an open seam in the
flashing

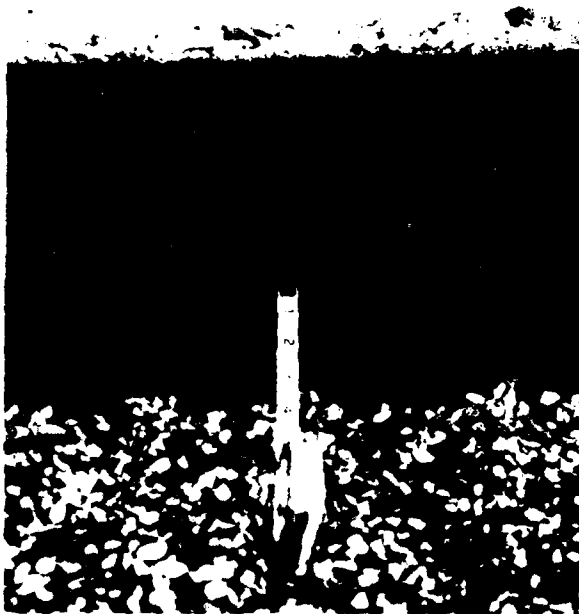


BF11 Base Flashing
<High Severity>
Flashing has sagged and is open



BF12 Base Flashing
<High Severity>
There is a hole through the
flashing material.



BF13 Base Flashing
 <High Severity>
 There is an open seam in the
 flashing

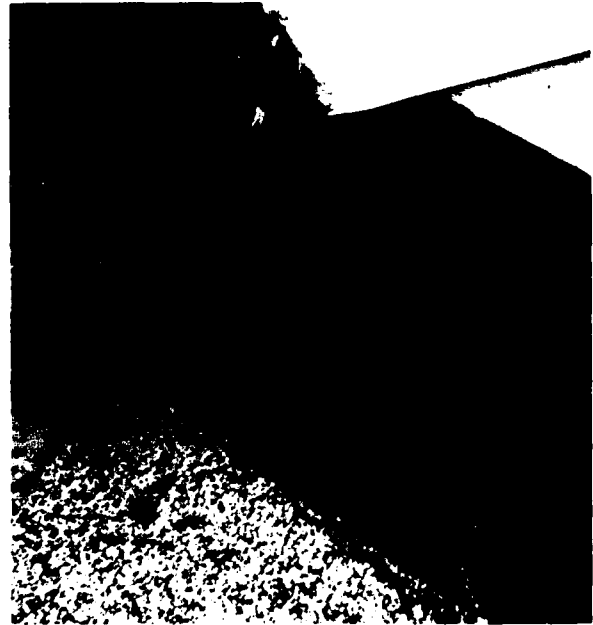

BF14 Base Flashing
 <High Severity>
 There is a hole in the flashing
 material

Base Flashing (BF)

METAL CAP FLASHING






Description: Metal cap flashing includes counterflashing and any sheet metal coping cap which serves as part of the counterflashing or the cover over a detail such as a roof area divider, equipment curb, raised roof edge, or an expansion joint (including the rubber bellows of an expansion joint).

Counterflashing is the material, usually sheet metal, which protects the top termination of base flashing and sheds water away from it. Counterflashing should be free to expand and contract.

Severity Levels:

Low: Any of the following conditions:

1. Loss of paint or protective coating or start of metal corrosion.
2. Metal coping cap is deformed and allows water to pond on the top.
3. Counterflashing is deformed but still performing its function.
4. Counterflashing has been sealed to the base flashing.

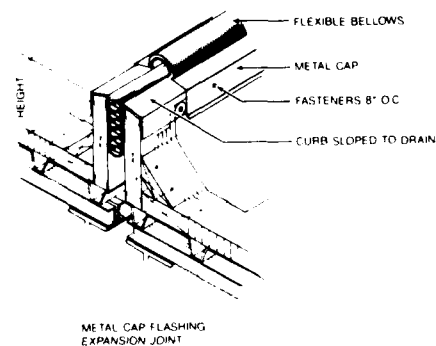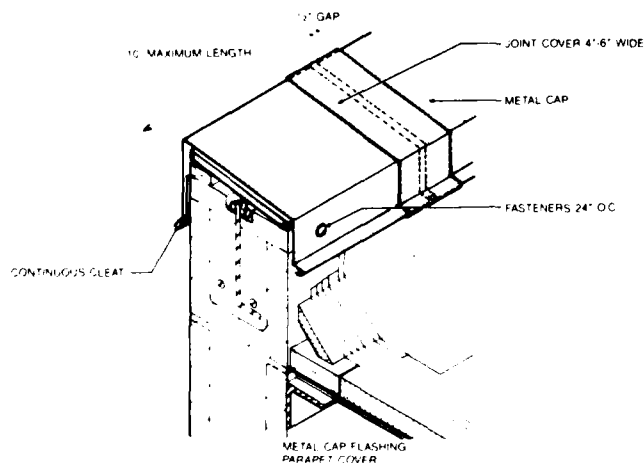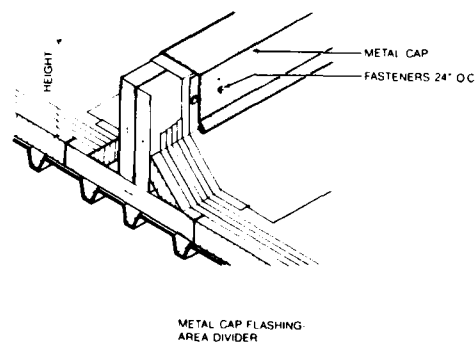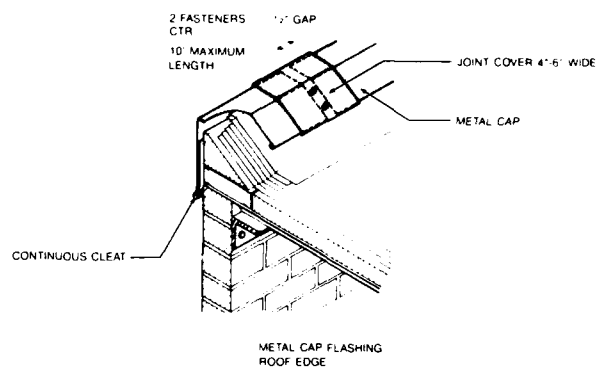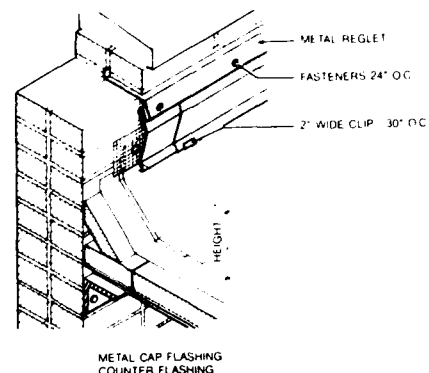

Metal Cap Flashing (MC)

Medium: Any of the following conditions:

1. Corrosion holes have occurred through the metal on a vertical surface.
2. Metal coping cap has loose fasteners, failure of soldered or sealed joints, open joints, or loss of attachment.
3. Sealant at reglet or top of counterflashing is missing or no longer functioning, allowing water to channel behind counterflashing.
4. Counterflashing is loose at the top, allowing water to channel behind it.
5. Counterflashing does not extend over top of base flashing.

High: Any of the following conditions:

1. Metal coping cap or counterflashing is missing or displaced from its original position.
2. Corrosion holes have occurred through the metal on a horizontal surface.
3. Metal coping cap has missing joint covers where joint covers were originally installed.

Measurement: Measure lineal feet of metal cap flashing having the above conditions. Individual defects (i.e., joints, holes) count as one foot minimum.

Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = length of metal cap flashing defects (ft)

B = total length of flashed perimeter of roof section being rated (including flashings for penthouses, courtyards, and curved projections)

Note: The problem density is calculated for each existing severity level.



MC1 Metal Cap Flashing
<Low Severity>
The metal has begun to corrode but
no holes are evident



MC2 Metal Cap Flashing
<Low Severity>
The metal is bent but still func-
tions; there is some corrosion



MC3 Metal Cap Flashing
<Low Severity>
The metal is bent but still is in
function



MC4 Metal Cap Flashing
<Low Severity>
The counterflashing has been
secured to the base flashing

Water Control on Roof MC



MC5 Metal Cap Flashing
 <Low Severity>
 Metal or accessories have been
 deformed or damaged



MC6 Metal Cap Flashing
 <Low Severity>
 Water can accumulate on top of
 the cap



MC7 Metal Cap Flashing
 <Medium Severity>
 The metal has been bent so that water
 can accumulate in the joint in the
 flashing.



MC8 Metal Cap Flashing
 <Medium Severity>
 The top of the counterflashing
 holds water

Metal Cap Flashing (MC)




MC9 Metal Cap Flashing
 <Medium Severity>
 The top of the counterflashing is loose



MC10 Metal Cap Flashing
 <Medium Severity>
 Joint in cap has failed; caulking has not corrected the problem.
 Also, Base Flashing has holes
 <High Severity>



MC11 Metal Cap Flashing
 <Medium Severity>
 Neoprene cover at joint has failed

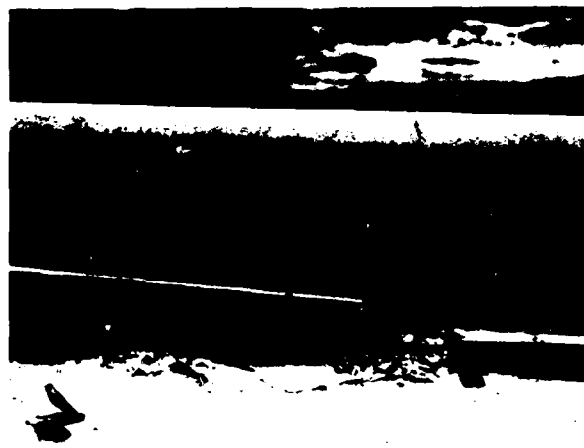

MC12 Metal Cap Flashing
 <High Severity>
 The metal counterflashing has fallen off of the wall

Metal Cap Flashing (MC)




MC13 Metal Cap Flashing
 <High Severity>
 The metal has corroded so that there are holes in the metal



MC14 Metal Cap Flashing
 <High Severity>
 Joint covers are missing



MC15 Metal Cap Flashing
 <No Severity level--report in remarks>
 The reglet has been cut into the top of the parapet wall; the caulking has failed

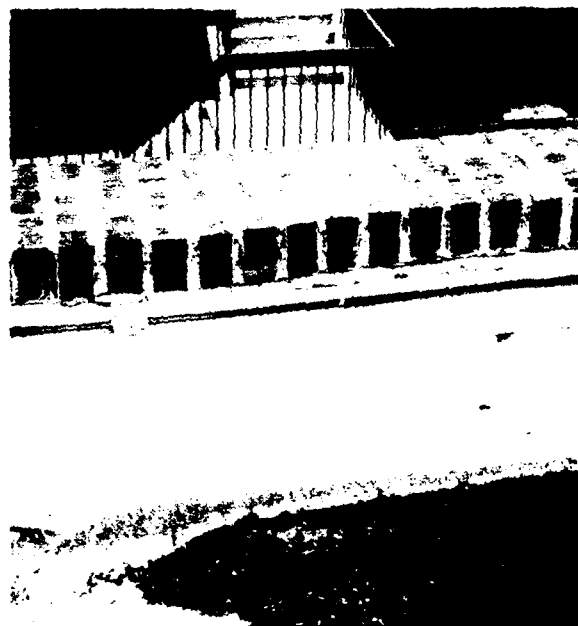

MC16 Metal Cap Flashing
 <No Severity level--report in remarks> There is no cap flashing; water has penetrated the masonry and deterioration has occurred due to freeze-thaw action

Metal Cap Flashing (MC)

EMBEDDED EDGE METAL

Description: Formed strip of metal at the roof edge which continues down the vertical part of the wall to form a fascia or drip. This stripped-in flashing provides a finished termination for the roofing membrane. A formed vertical projection (gravel stop) may be incorporated to prevent loose aggregate from rolling or washing off the roof. Exterior and interior gutters, which are embedded into the membrane, are considered as embedded edge metal. (An interior gutter is a built-in trough of metal or other material which collects water from the roof and carries it to a downspout.)

Note: A raised roof edge which is not stripped in, is rated as metal cap flashing and not as embedded edge metal.

Severity Levels:

Low:

1. The entire length of embedded edge metal flashings is rated low severity as a minimum due to the maintenance problems associated with it.

Medium:

Any of the following conditions:



1. The joints in embedded edge metal flashings are rated medium severity as a minimum due to the maintenance problems associated with them.
2. Nails under the stripping felts are backing out.
3. Corrosion of the metal.
4. Loose or lifted metal flange without deterioration of the stripping felts.
5. The entire length of interior gutter is rated medium severity as a minimum due to the maintenance problems and high potential for leak damage associated with its presence.

High:

Any of the following conditions:

1. Stripping felts are missing or loose.
2. Splits in the stripping felts above the metal joints.
3. Holes have occurred through the metal.
4. Loose or lifted metal flange with deterioration of the stripping felts.
5. Holes or joint movement are present in the interior gutter.

Measurement: Measure lineal feet of embedded edge metal flashing having the above conditions. Each split above a joint is counted as one foot. As a method of sampling the joints, determine the total number of joints by dividing the total length of embedded edge metal flashing by the length of edge metal sections (normally 10 ft). Every fourth

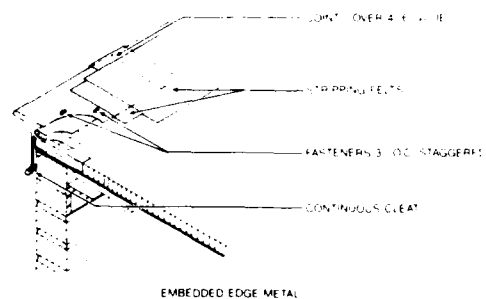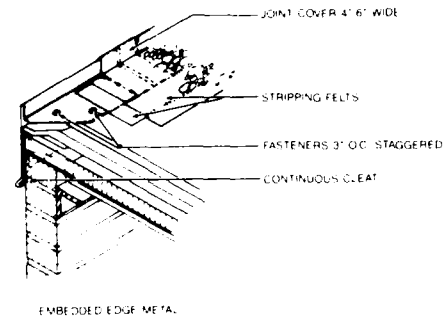

Embedded Edge Metal (EM)

joint should be inspected for splits in the stripping felts. Count the number of inspected joints that are high severity and multiply by 4 to determine the total lineal feet of high severity joints. All other joints are rated medium severity. Multiply the number of inspected joints not rated high severity by 4 to determine the total lineal feet of medium severity joints.

Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = length of embedded edge metal flashing defects (ft)

B = total length of flashed perimeter of roof section being rated (including flashings for penthouses, courtyards and curbed projections)

Note: The problem density is calculated for each existing severity level.

Causes:

1. Splits in the stripping felts and loose stripping felts are caused by:
 - Insufficient or improper nailing of the metal flange allowing it to move.
 - Insufficient or no priming of the metal flange (top and bottom) before installation. This prevents bonding of the bitumen to the metal.
 - The widely different expansion coefficients of the metal and bituminous components.
2. Exposed metal flanges can result from stripping felt deterioration or the flange may never have been stripped-in.
3. Loose or lifted metal edge is caused by insufficient fastening, rotting, or lack of a wood perimeter nailer.



EM1 Embedded Edge Metal
 <Low Severity>
 Tapered edge metal is raised but
 strip-in still presents a potential
 hazard



EM2 Embedded Edge Metal
 <Medium Severity>
 There are interior gutters



EM3 Embedded Edge Metal
 <High Severity>
 The stripping shows the beginning of
 a tear or break




EM4 Embedded Edge Metal
 <High Severity>
 The metal is loose or lifted


Embedded Edge Metal (EM)




EM5 Embedded Edge Metal
 <Medium Severity>
 Stripping felts are missing

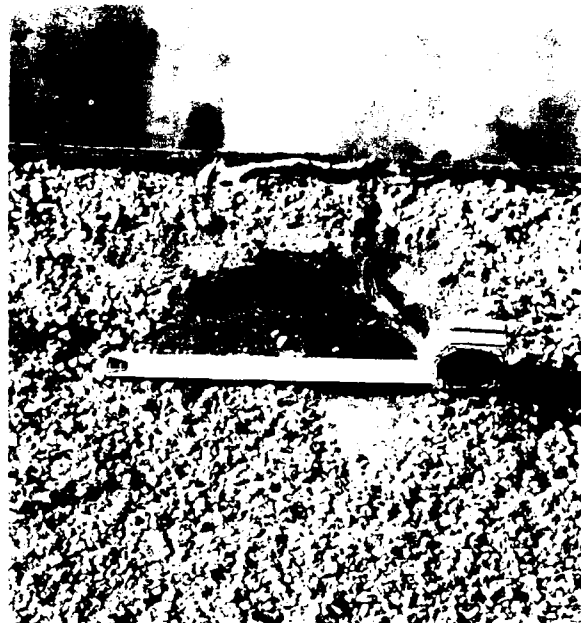

EM6 Embedded Edge Metal
 <High Severity>
 The stripping is torn or broken

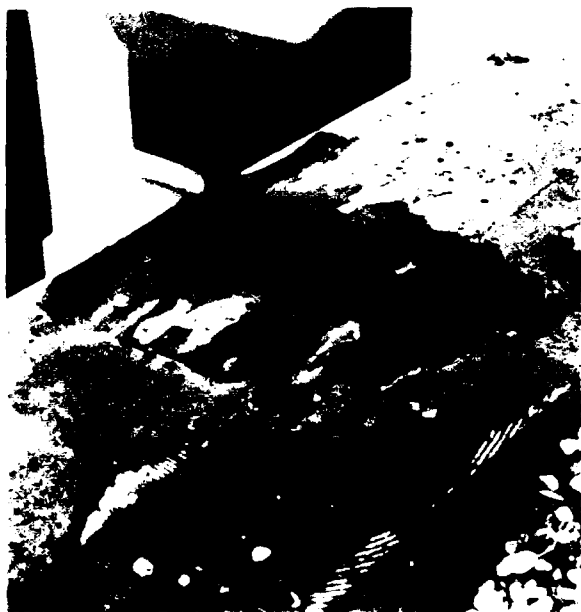

EM7 Embedded Edge Metal
 <High Severity>
 The metal movement has torn the stripping

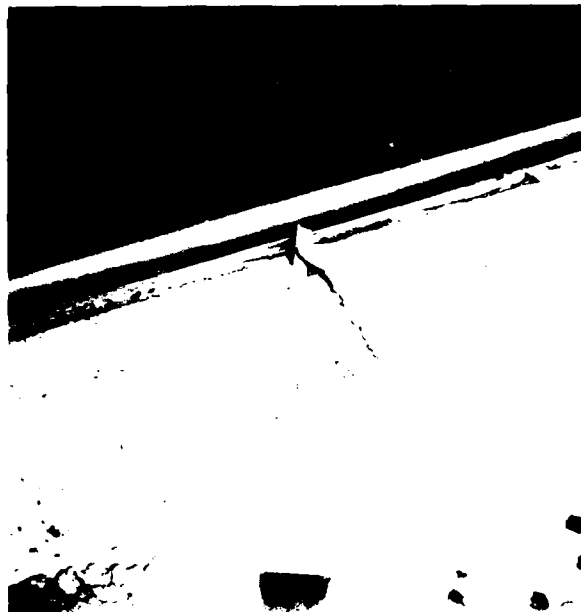

EM8 Embedded Edge Metal
 <High Severity>
 The stripping felts are torn

Embedded Edge Metal and Moisture



EM9 Embedded Edge Metal
 <High Severity>
 The stripping felt is torn along the
 back edge of the embedded metal



EM10 Embedded Edge Metal
 <High Severity>
 The edge metal is bent or
 deformed; the stripping is torn



EM11 Embedded Edge Metal
 <High Severity>
 The stripping is torn

Embedded Edge Metal

FLASHED PENETRATIONS

Description: Open pipes, plumbing vent stacks, flues, ducts, continuous pipes, guy wires, drain sumps, and other penetrations through the roof membrane (excluding pitch pans but including metal curbing for hatches and ventilators, where the flange is stripped into the membrane).

Severity Levels:

Low: Either of the following conditions:

1. Flashing sleeve is deformed.
2. Opening in the penetration or flashing is less than 6 in. above the roof surface.

Medium: Any of the following conditions:

1. Edge of stripping felts is exposed but there is no apparent felt deterioration.
2. Top of flashing sleeve is not sealed or has not been rolled down into an existing plumbing vent stack.
3. The sleeve or umbrella is open or no umbrella is present (where required).
4. Metal is corroded.

High: Any of the following conditions:

1. Flashing sleeve or metal curb has been installed with no stripping felts.
2. Flashing sleeve or metal curb is cracked, broken, or corroded through.
3. No flashing sleeve is present.
4. Penetration is not sealed at the membrane level.

Measurement: Count each distressed flashed penetration as one linear ft at the highest severity level which exists. For metal curbs and ducts with greater than 1 ft of perimeter, count the actual length (in feet) of distressed perimeter.



Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$


where A = lineal feet of distressed flashed penetrations

B = total length of flashed perimeter of roof section being rated (including flashings for penthouses, courtyards and curbed projections)

Note: The problem density is calculated for each existing severity level.

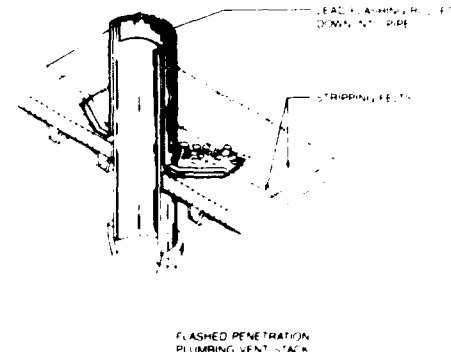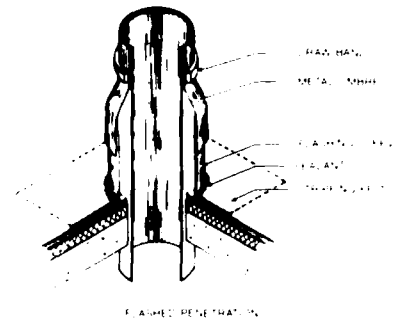

Flashed Penetrations (FP)

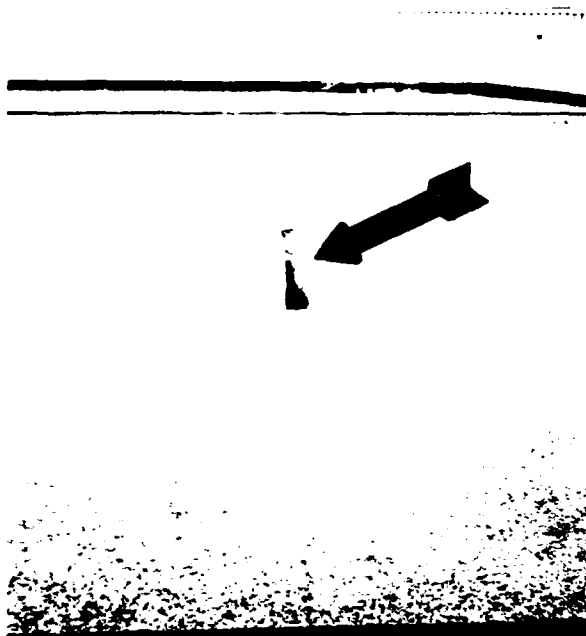

FP1 Flashed Penetration
 <Low Severity>
 The vent stack is distorted due to movement of the membrane



FP2 Flashed Penetration
 <Low Severity>
 The top of the flashing is less than 6 in. above the finished roof



FP3 Flashed Penetration
 <Low Severity>
 The top of flashing sleeve is not sealed




FP4 Flashed Penetration
 <Medium Severity>
 The lead had not been rolled down into the vent

Flashed Penetrations (FP)



FP5 Flashed Penetration
 <Medium Severity>
 The seal at the umbrella is broken

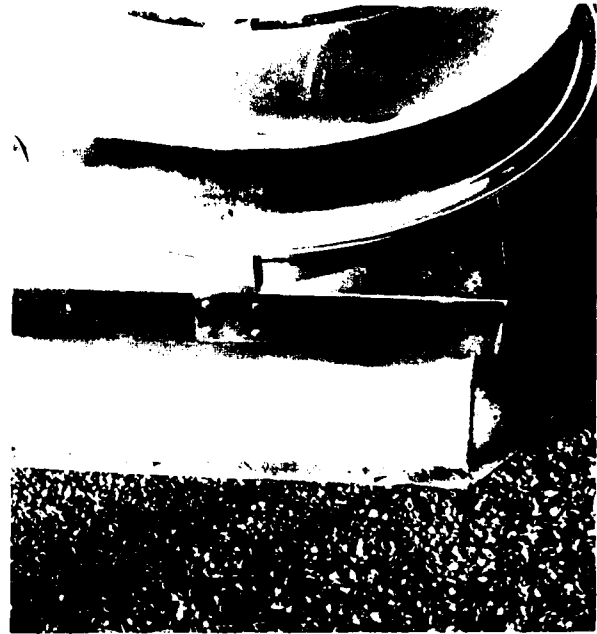

FP6 Flashed Penetration
 <Medium Severity>
 The flashing curb has not been
 stripped-in




FP7 Flashed Penetration
 <Medium Severity>
 The flashing sleeve is cracked or
 broken



FP8 Flashed Penetration
 <Medium Severity>
 The flashing umbrella is missing

Flashed Penetrations (FP)

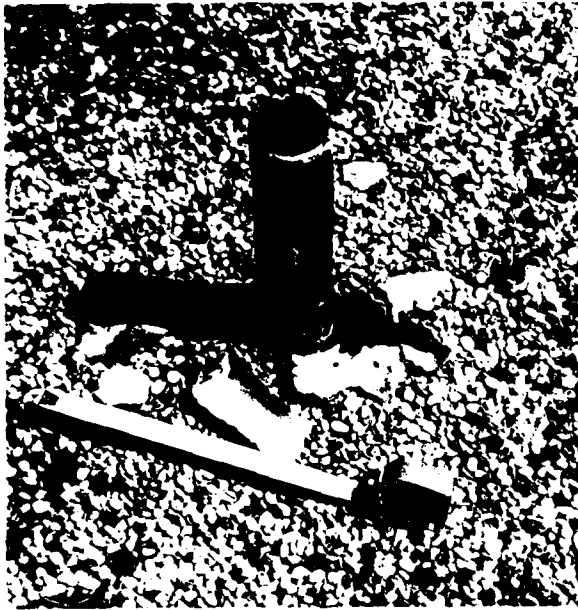

FP9 Flashed Penetration
 <High Severity>
 The lead flashing is broken



FP10 Flashed Penetration
 <High Severity>
 The joint in the metal sleeve has failed




FP11 Flashed Penetration
 <High Severity>
 The metal has corroded and holes are evident



FP12 Flashed Penetration
 <High Severity>
 The metal flashing has been left out

Flashed Penetrations (FP)

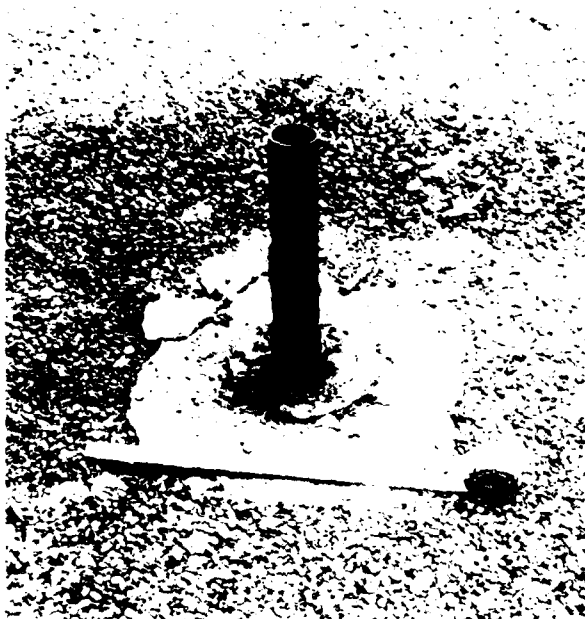

FP13 Flashed Penetration
 <High Severity>
 Unflashed pipe penetration sealed
 with roofing cement



FP14 Flashed Penetration
 <High Severity>
 Guy wire anchor has not been
 flashed



FP15 Flashed Penetration
 <High Severity>
 The sleeve around the penetration is
 missing; the conduit is lying on the
 roof without supports

Flashed Penetrations (FP)

PITCH PANS

Description: A pitch pan is a flanged metal sleeve placed around a roof-penetrating element and filled with a sealer.

Severity Levels:

Low:

1. Pitch pans are rated low severity as a minimum due to the maintenance problems associated with them.

High: Any of the following conditions:

1. Metal corrosion.
2. Sealing material is below metal rim.
3. Stripping felts are exposed or deteriorated.
4. Sealing material has cracked or separated from pan or penetration.

Measurement: Each distressed pitch pan should be counted once at the highest severity level which exists.


Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = number of distressed pitch pans

B = total length of flashed perimeter of roof section being rated (including flashings for penthouses, courtyards, and curbed projections)

Note: The problem density is calculated for each existing severity level.

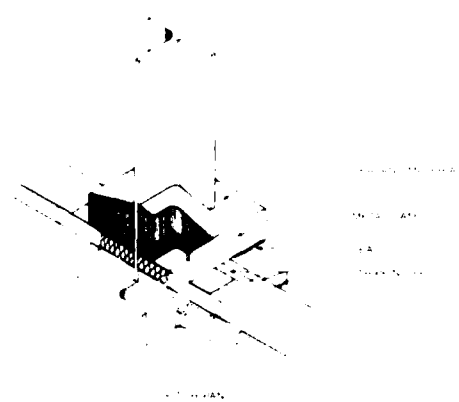



PP1 Pitch Pans
<Low Severity>
Pitch pan installed and maintained
correctly but presents a hazard



PP2 Pitch Pans
<High Severity>
Metal shows light corrosion



PP3 Pitch Pans
<High Severity>
Water standing in pitch pan; fill
material not complete




PP4 Pitch Pans
<High Severity>
Fill material is low; water
standing in pan

Pitch Pans (PP)



PP5 Pitch Pans
<High Severity>
Sides of pan are distorted; fill
material is low

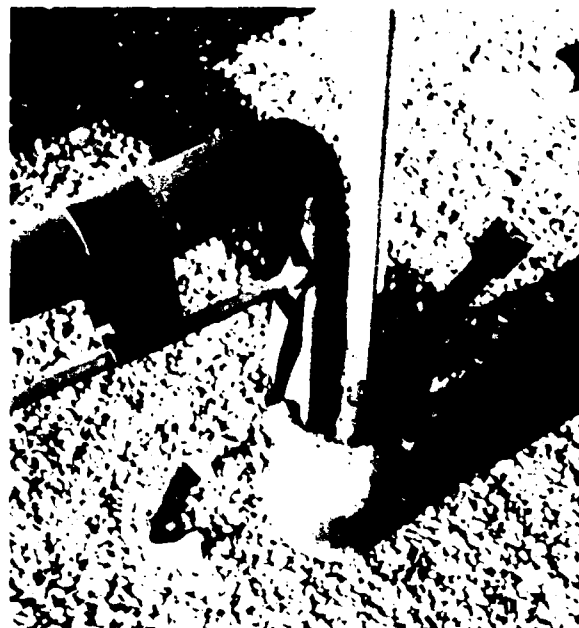

PP6 Pitch Pans
<High Severity>
Pipe sleeve used as pitch pan
has not been filled



PP7 Pitch Pans
<High Severity>
Fill material has pulled away from
the sides of the pan



PP8 Pitch Pans
<High Severity>
Material has pulled away; water
can penetrate pan

Pitch Pans (PP)



PP9 Pitch Pans
<High Severity>
Pan not full

Pitch Pans (PP)

INTERIOR DRAINS AND ROOF LEVEL SCUPPERS

Description: A drain is a penetration at the roof membrane which allows water to flow from the roof surface into a piped drainage system. The drain fixture at the roof has a flange and/or clamping arrangement to which the roofing membrane is attached. A roof level scupper is a channel through a parapet or raised roof edge which is designed for peripheral drainage of the roof.

Note: Stripping felts around scuppers should be carefully inspected for holes at corners.

Severity Levels:

Low:

1. Bitumen has flowed into the drain leader but the drain is not clogged.

Medium: Any of the following conditions:

1. Stripping felts are exposed but there is no apparent deterioration of felts.
2. Strainer is broken or missing.
3. Scupper shows loss of paint or protective coating or start of metal corrosion.

High: Any of the following conditions:

1. Stripping felts have holes or are deteriorated.
2. Clamping ring is loose or missing from drain body or bolts are missing.
3. Drain is clogged.
4. Scupper metal is broken or holes have occurred through the metal.

Measurement: Each distressed drain and scupper should be counted once at the highest severity level which exists.



Density:


$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = number of distressed interior drains and roof level scuppers
B = total length of flashed perimeter of roof section being rated (including flashings for penthouses, courtyards and curbed projections)


Note: The problem density is calculated for each existing severity level.

Interior Drains and Roof Level Scuppers (DR)

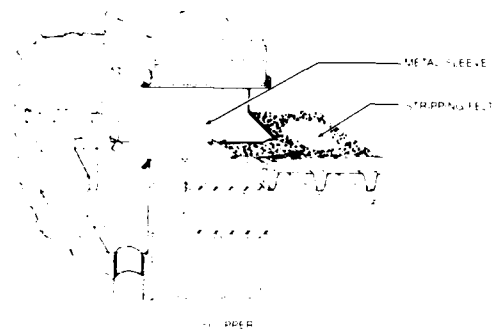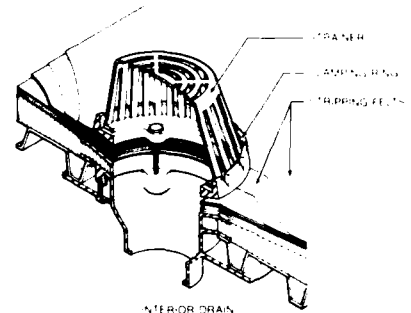


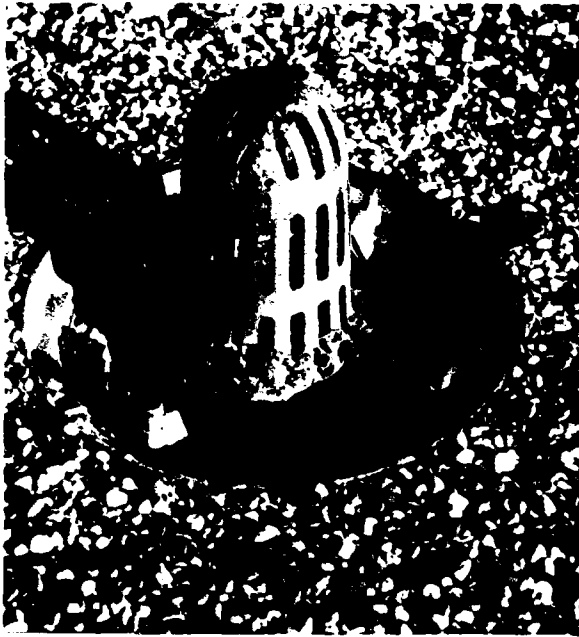

DR1 Drains and Scuppers
 <Low Severity>
 Bituminous material has flowed into
 the drain

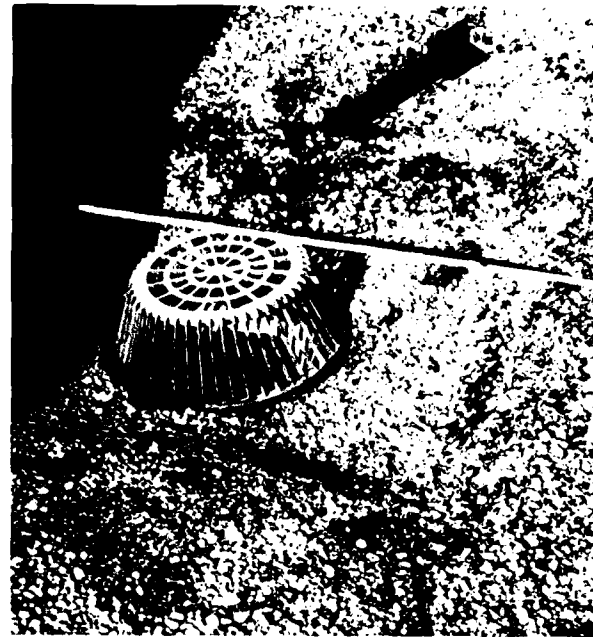

DR2 Drains and Scuppers
 <Medium Severity>
 The felts around the drain are
 exposed

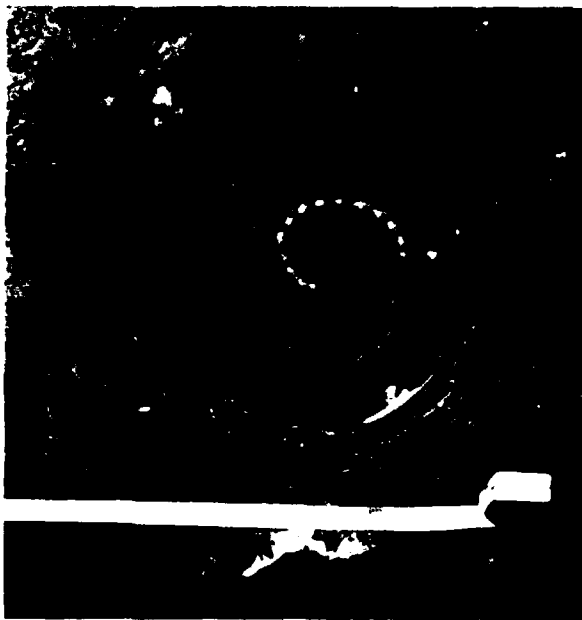

DR3 Drains and Scuppers
 <Medium Severity>
 The strainer is broken




DR4 Drains and Scuppers
 <High Severity>
 The clamping ring is loose. Bolts
 are lying next to the ring

Interior Drains and Roof Level Scuppers (DR)



DR5 Drains and Scuppers
 <High Severity>
 The clamping ring is missing; also,
 the strainer is broken and the drain
 is clogged with bitumen

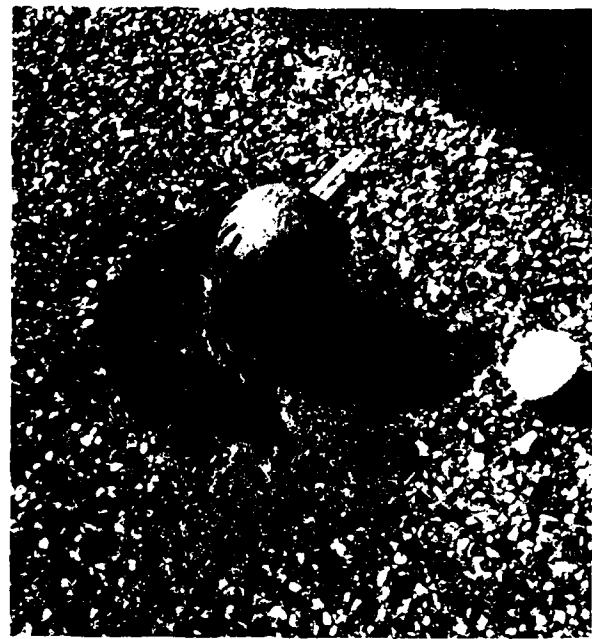

DR6 Drains and Scuppers
 <High Severity>
 The drain is clogged



DR7 Drains and Scuppers
 <High Severity>
 The drain is clogged, the clamping ring
 is missing, and the strainer is broken



DR8 Drains and Scuppers
 <High Severity>
 The drain is clogged

Interior Drains and Roof Level Scuppers (DR)

4 MEMBRANE DISTRESSES


Index

<u>Distress</u>	<u>Page</u>
Blisters	54
Ridges	57
Splits	60
Holes	62
Surface Deterioration	63
Slippage	68
Patching	70
Debris and Vegetation	73
Improper Equipment Supports	76
Ponding	80

BLISTERS

Description: Blisters are round or elongated raised areas of the membrane which are filled with air.

Note: Blisters and ridges are difficult to differentiate at the low and medium severity levels. The rating error will be insignificant because of the similarity in the deduct curves. At high severity, however, it is important to distinguish between the two distresses due to their different leak potentials.

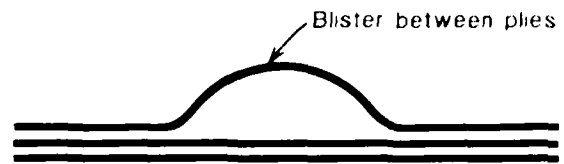

Graphic Representation
of Blister

Severity Levels:

Low:

1. The raised areas are noticeable by vision or feel. The surfacing is still in place and the felts are not exposed.

Medium:

1. The felts are exposed or show deterioration.

High:

1. The blisters are broken.

Measurement:

1. Measure the length and width of the blister in lineal feet and calculate the area (length times width). If the distance between individual blisters is less than 5 ft, measure the entire affected area in sq ft.
2. When large quantities of this problem are present (especially on large roofs), the representative sampling technique can be used.

Density:


$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = total area of membrane blisters (sq ft)
B = total area of roof section being rated (sq ft)

Note: The problem density is calculated for each existing severity level.

Causes: Blisters are caused by voids or lack of attachment within the membrane. Moisture and gasses within the void greatly increases the potential for growth.

Blisters (BL)

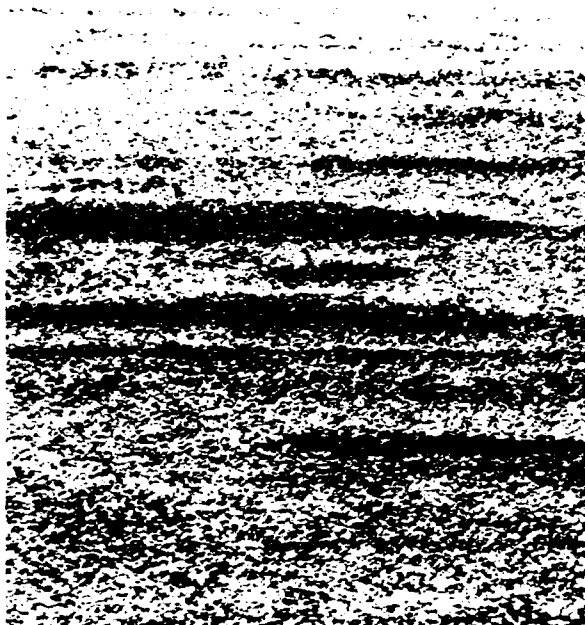

BL1 Blisters
 <Low Severity>
 Low severity blisters.
 The surface is still in place



BL2 Blisters
 <Low Severity>
 Large blister but still low severity
 level



BL3 Blisters
 <Low Severity>
 Blisters in walk pad application




BL4 Blisters
 <Low Severity>
 Blisters in gravel surfaced
 membrane



BL5 Blisters
<Low Severity>
General blistering over all of roof
surface



BL6 Blisters
<Low Severity>
Blisters in cap sheet

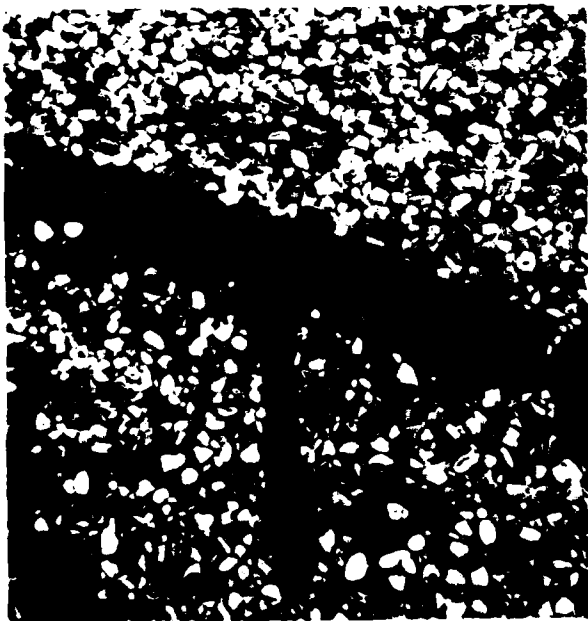

BL7 Blisters
<Medium Severity>
Blister is bare and felts are
starting to show wear




BL8 Blisters
<High Severity>
Blister has broken

Blisters (BL)

RIDGES

Description: Ridges are long, narrow (usually less than 3 in.), raised portions of the roof membrane. Their maximum height is about 2 in. Usually ridges occur directly above the insulation board joints and run perpendicular or parallel to the felts. They include all the plies and therefore are generally stiffer than blisters.

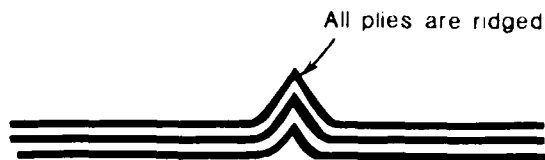

Graphic Representation
of Ridge

Note: Blisters and ridges are difficult to differentiate at the low and medium severity. The rating error will be insignificant because of the similarity in the deduct curves. However at the high severity, it is important to distinguish between the two distresses due to their different leak potentials.

Severity Levels:

Low:

1. The ridges are noticeable but the felts are not exposed.

Medium:

1. The ridges are raised and clearly visible. The surfacing on the ridge is gone and the top felt is exposed.

High: Either of the following conditions:

1. Open breaks have developed in the ridge.
2. Felt deterioration has progressed through the top ply, exposing underlying plies.

Measurement: Measure lineal feet of ridges running in all directions.

Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = total length of membrane ridges (ft)

B = total area of roof section being rated (sq ft)

Note: The problem density is calculated for each existing severity level.

Causes: Ridging can be the result of internally generated moisture vapor collecting at insulation joints and affecting the membrane or of movement of the substrate.

Ridges (RG)



RG1 Ridges
 <Low Severity>
 Beginnings of ridges evident in
 surface; some picture framing evident



RG2 Ridges
 <Medium Severity>
 Closeup of medium severity
 ridging condition




RG3 Ridges
 <Low Severity>
 Ridges in a smooth surface membrane




RG4 Ridges
 <Medium Severity>
 Bare felt showing; some slippage
 of felt at lap is evident

Ridges (RG)

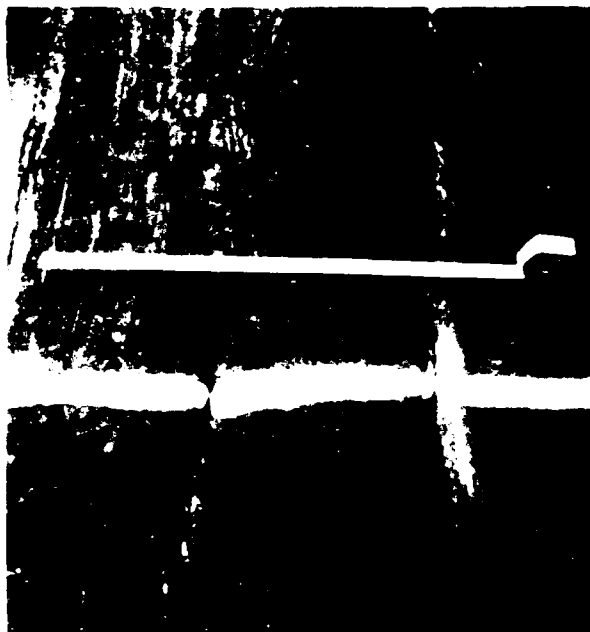

RG5 Ridges
 <Medium Severity>
 Smooth surface membrane

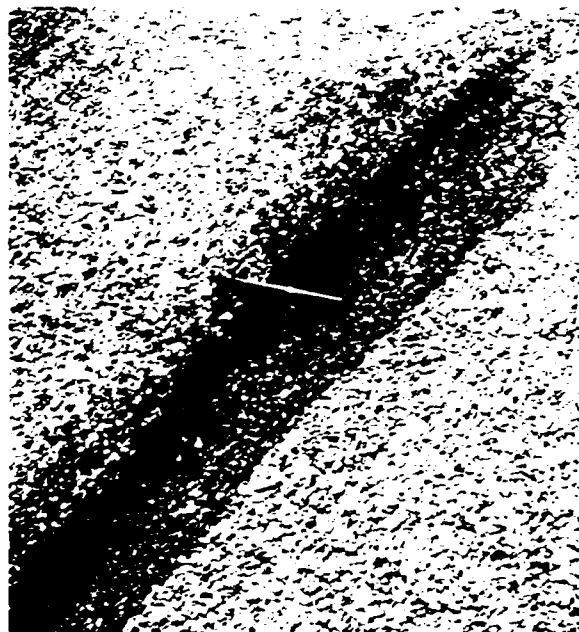


RG6 Ridges
 <High Severity>
 Felts are distorted; felt lap is
 opening up; first felt shows
 deterioration



RG7 Ridges
 <High Severity>
 Ridge has collapsed; felt
 is broken in form

SPLITS

 Description: Splits are tears that extend through all membrane felts. They vary in length from a few feet to the length of the roof and in width from a hair-line crack to more than 1 in. Splits generally occur directly above the joints between the long sides of insulation boards and run in the direction the felts were installed.



Graphic Representation
of Split

Severity Levels:

High:

1. An unrepaired split or a repaired split which has started to re-open.

Measurement: Measure lineal feet of split.

Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = total length of membrane splits (ft)
B = total area of roof section being rated (sq ft)

Causes:


1. The membrane is too weak.
2. There is little or no attachment between any of the following: membrane, insulation, vapor retarder (if any), and deck.
3. Areas of the membrane have missed headlaps.
4. Differential movement at deck joints.
5. Structural movement within the roof system.
6. Stress concentration due to shrinkage cracking of a poured deck.




SP1 Splits
 <High Severity>
 Long split over structural member;
 yellow markings indicate water
 penetration determined by infrared
 (IR) scanning



SP2 Splits
 <High Severity>
 Closeup of split in gravel surface;
 repair attempt made using mastic
 without reinforcing fabric

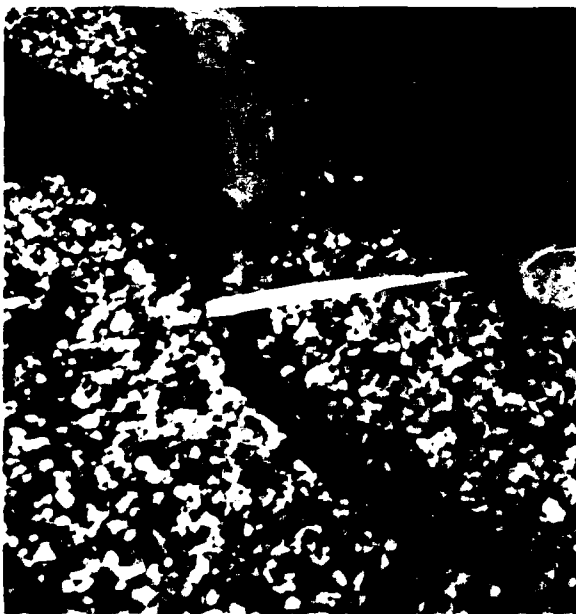

SP3 Splits
 <High Severity>
 Large split in gravel surface roof

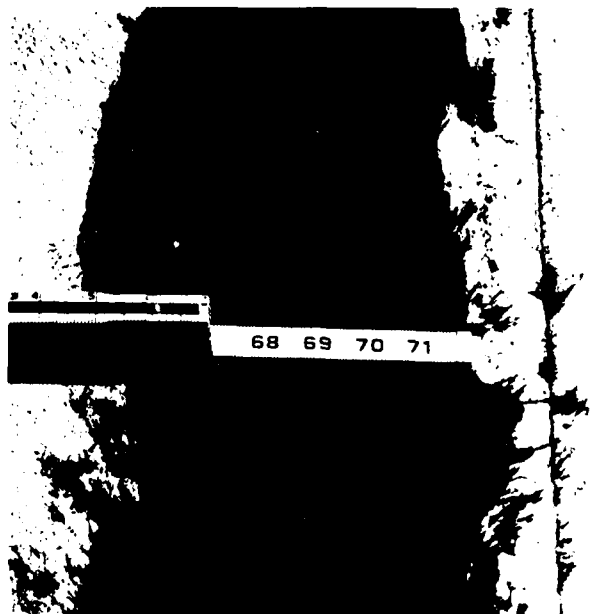

SP4 Splits
 <High Severity>
 Split in mineral cap sheet

Splits (SP)

HOLES

Description: A membrane hole is any visible opening which extends through all membrane layers. Holes can be of various sizes and shapes, and can be located anywhere on the roof surface.

Severity Levels:

High:

1. All holes in the membrane are considered high severity due to their high leak potential.


Measurement: Count the total number of holes in the membrane. If the distance between two holes is less than 1 ft, count them as one hole.

Density:


$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = number of membrane holes

B = total area of roof section being rated (sq ft)

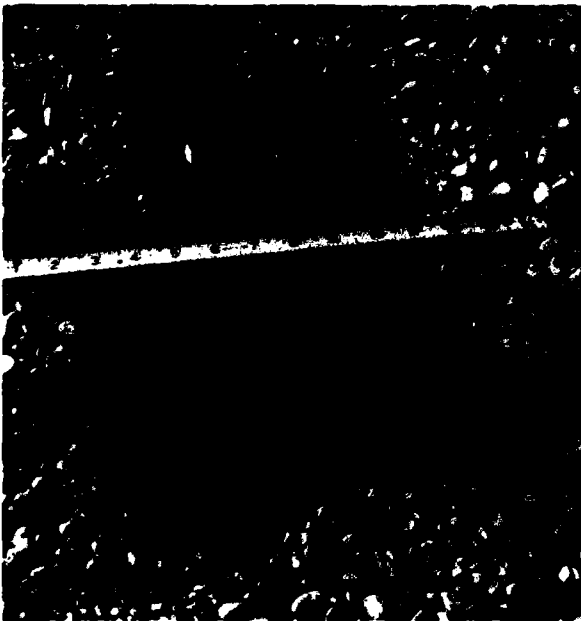

HL1 Holes
<High Severity>
Membrane below gravel surface has
been penetrated by a sharp object

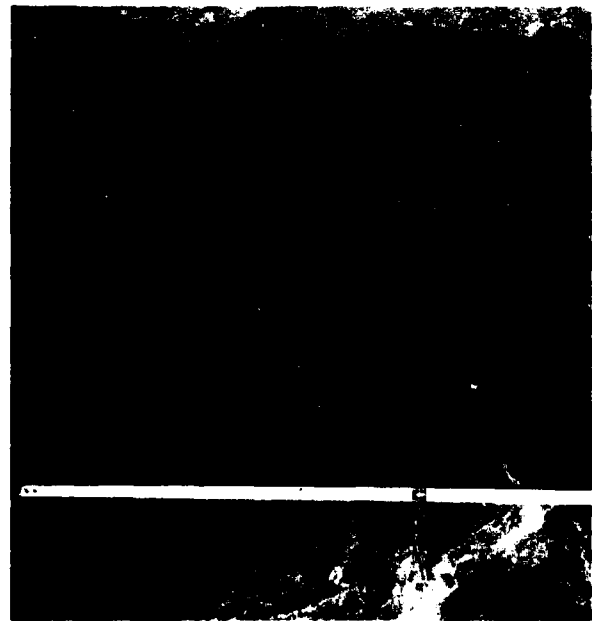

HL2 Holes
<High Severity>
Holes in smooth surfaced
roof

Holes (HL)

SURFACE DETERIORATION

Description: A built-up roofing membrane will generally have one of the following types of surfacing: aggregate surface, mineral surface-cap or smooth surface-coated. The membrane surface may show any of the following distressed conditions:

1. Lack of top surface or coating.
2. Alligatoring (interconnected hairline cracks that resemble alligator hide).
3. Lack of adhesion between the membrane plies.

Note: Walkways are treated as part of the membrane surfacing.

Severity Levels:

Low: Any of the following conditions:

1. On aggregate surfaced roofs, the aggregate is not embedded or is poorly embedded but the felts remain covered with aggregate.
2. Open edge laps or fishmouths.
3. On smooth surfaced roofs, there is evidence of crazing of top surface with hairline cracks (alligatoring).
4. Walkway shows loss of surfacing, loss of adhesion, cracks, blistering or cracked coating.

Medium: Any of the following conditions:

1. On aggregate surfaced roofs, the aggregate is displaced and the top coat of bitumen is exposed.
2. On mineral surfaced-cap sheet roofs, the mineral granules have come off the cap sheet, exposing the underlying felt.
3. On smooth surfaced roofs, no surface coating exists or there is a loss of surface coating.
4. On smooth surfaced roofs, alligator cracks extend down through the bitumen to the top felt.

High: Any of the following conditions:

1. On aggregate surfaced roofs, the aggregate cover has been displaced and the bitumen pour coat is deteriorated, leaving the underlying felts exposed. The felts may be deteriorated.
2. On mineral surfaced-cap sheet roofs, the cap sheet felt is deteriorated.
3. On smooth surfaced roofs, alligator cracks extend down through one or more plies.
4. Shrinking of the walkway has torn the membrane below it.

Measurement:

1. Measure square feet of each affected area and rate at highest severity level which exists.
2. When large quantities of this problem are present (especially on large roofs), the representative sampling technique can be used.

Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = total area of surface deterioration (sq ft)
B = total area of roof section being rated (sq ft)


Note: The problem density is calculated for each existing severity level.

Causes:


1. Inadequate top pour coat.
2. Little or no embedment of aggregate.
3. Wind erosion such as occurs at roof corners and water erosion such as occurs when downspouts empty directly onto the membrane.
4. Use of bitumen on a slope that is greater than proper for that bitumen. The bitumen and gravel run off, leaving the felts exposed. This can affect localized areas or the entire roof.
5. Alligatoring results from overapplication of bitumen or aging bitumen, combined with weathering and temperature cycling. The bitumen gradually loses the ability to flow back together and alligatoring is enhanced.



SR1 Surface Deterioration
 <Low Severity>
 Gravel is loose and easily displaced
 by wind; imbedment of gravel is minimal
 <Medium Severity>
 Bare areas

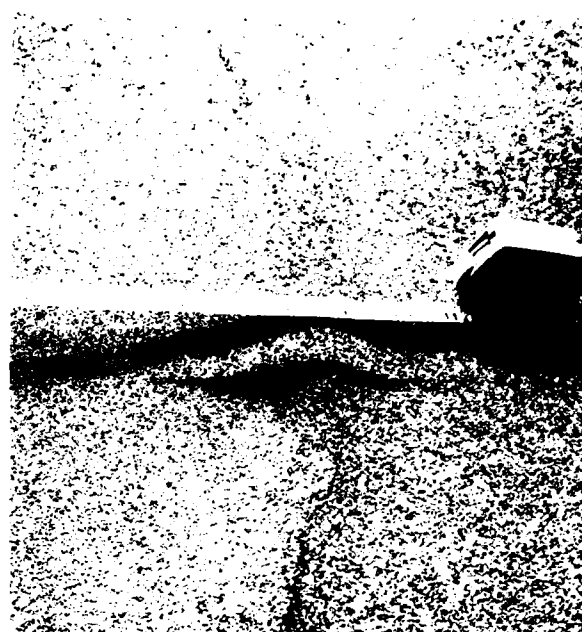

SR2 Surface Deterioration
 <Low Severity>
 There are open edge laps or
 fishmouths

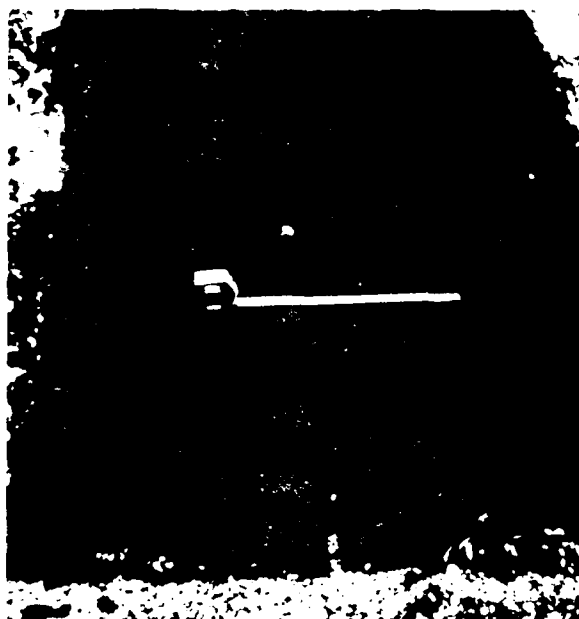

SR3 Surface Deterioration
 <Low Severity>
 Walkways are cracked or blistered



SR4 Surface Deterioration
 <Low Severity>
 Hairline alligator cracking of the
 surface is evident



Surface Deterioration (SR)



SR5 Surface Deterioration
 <Medium Severity>
 Granule surface on cap sheet is eroded



SR6 Surface Deterioration
 <Medium Severity>
 Loss of surface coating on smooth surface roof



SR7 Surface Deterioration
 <Medium Severity>
 Alligator cracking of the surface extends down to the felt



SR8 Surface Deterioration
 <Medium Severity>
 Alligator cracking of the surface extends down to the felt

Surface Deterioration SR1




SR9 Surface Deterioration
<Medium Severity>
Gravel surfacing shows erosion from
wind coming over corner of building



SR10 Surface Deterioration
<High Severity>
Gravel surfacing is gone and felts
are starting to show wear



SR11 Surface Deterioration
<High Severity>
Smooth surface membrane is
detached

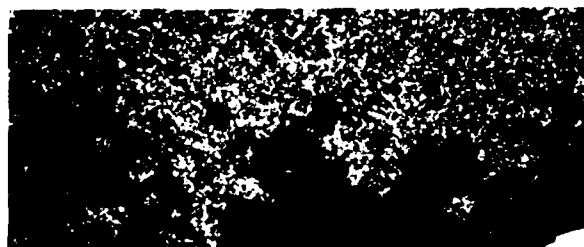

SR12 Surface Deterioration
<High Severity>
Cap sheet is completely worn and
feeling torn and broken

Surface Deterioration (SR)

SLIPPAGE

Description: Slippage is a downslope lateral movement of felt plies. Slippage usually occurs on roofs with slopes greater than 1/4 in./ft.

Severity Levels:

Low:

1. Less than 2 in. of slippage has occurred, evidenced by the presence of narrow bare strips perpendicular to the slope.

Note: Low severity slippage requires inspection at 6 month intervals.

High:

1. More than 2 in. of slippage has occurred. There is evidence of humping and wrinkling.

Measurement: Measure square feet of affected roof area. The affected area extends from the high point on the slope where bare felts are noticeable, down to the low point of the slope or the area where humping and wrinkling are noticeable.

Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = total affected area of roof (sq ft)

B = total area of roof section being rated (sq ft)

Note: The problem density is calculated for each existing severity level.

Causes:

1. Inadequate fastening of felts for the amount of roof slope present.
2. Use of improper bitumen.
3. Thickness of asphalt interply moppings is too great, reducing horizontal shear resistance between felt plies.
4. Phased construction, where the base sheet is glazed and felts applied at a later date.



SI.1 Supp 15"
 Flow Section
 Supp 15" is the top section of the
 top of section



SI.2 Supp 15"
 High Section
 Supp 15" is the top section of the



SI.3

PATCHING

Description: A localized repair of the membrane done with cold-applied roofing cement with fabric or felt embedded in it, with hot bitumen and felts, or with a modified bitumen system. It should be obvious that the work is not part of the original roof construction.

Severity Levels:

Low:

1. All patches are rated low severity as a minimum.

Medium:

1. The materials and workmanship of the patch are not equal to or better than the existing membrane.

High:

1. Ruptures or other membrane distresses of at least medium severity are present within the patched area (count as patching distress only).

Measurement:

1. Measure square feet of each patch having the above conditions.
2. When large quantities of this problem are present (especially on large roofs), the representative sampling technique can be used.

Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = total area of patching (sq ft)
B = total area of roof section being rated (sq ft)

Note: The problem density is calculated for each existing severity level.



PA1 Patching
<Low Severity>
Patching is evident in smooth
surfaced roof.



PA2 Patching
<Low Severity>
Patching is evident in
gravel surfaced roof




PA3 Patching
<Medium Severity>
Patching material is not the same
as the original roof



PA4 Patching
<High Severity>
Patched area has a high severity
blister

Patching (PA)

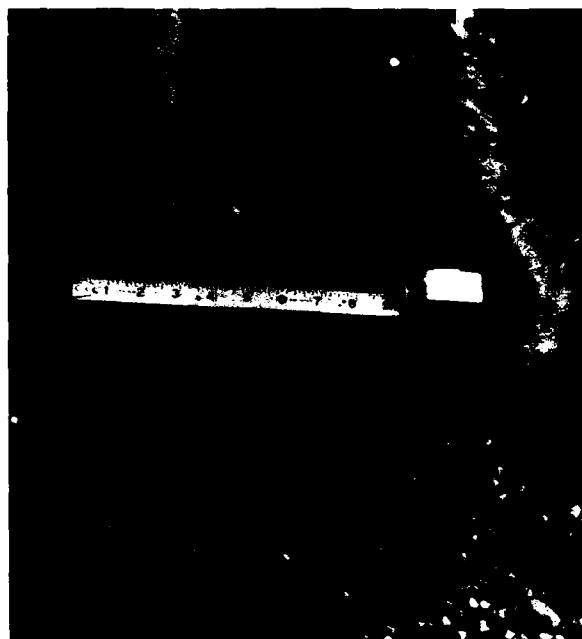

PA5 Patching
<High Severity>
Patched area has a split

Patching (PA)

DEBRIS AND VEGETATION

Description:

1. Foreign objects on the roof which could damage or puncture the membrane.
2. The growth of vegetation on the roof.
3. Accumulation of solvent and oil drippings on the roof.

Severity Levels:

Medium: Any of the following conditions:

1. The collection of foreign objects which are not removed from the roof during the inspection.
2. Grease, solvent, or oil drippings on the roof which show no degradation of the roof membrane.
3. Evidence of vegetation, but not penetrating the felts.

High: Any of the following conditions:

1. Grease, solvent, or oil drippings on the roof which is causing degradation to the roofing system.
2. Vegetation roots that have penetrated the felts.

Measurement: Measure square feet of affected area. Each isolated case of debris and vegetation of less than 1 sq ft in area should be counted as 1 sq ft.

Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = total area of debris and vegetation (sq ft)
B = total area of roof section being rated (sq ft)


Note: The problem density is calculated for each existing severity level.



DV1 Debris and Vegetation
Fire container left on roof;
inspector should remove



DV2 Debris and Vegetation
<Medium Severity>
Accumulation of tree needles
on roof

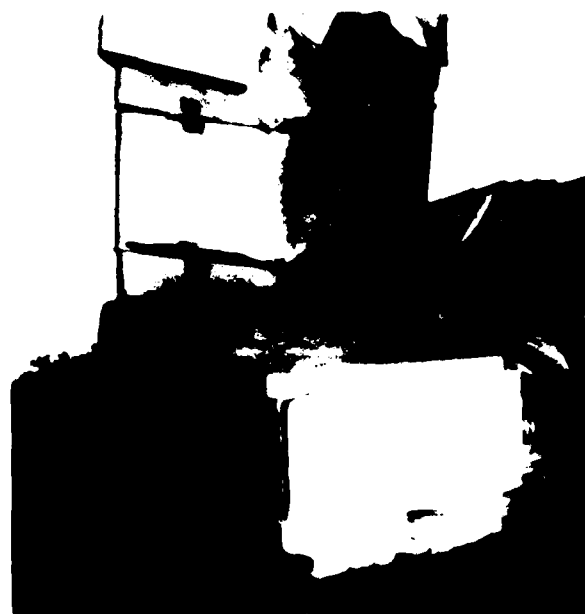


DV3 Debris and Vegetation




DV4 Debris and Vegetation



DV5 Debris and Vegetation
 (Medium Severity)
 Grass growing on roof

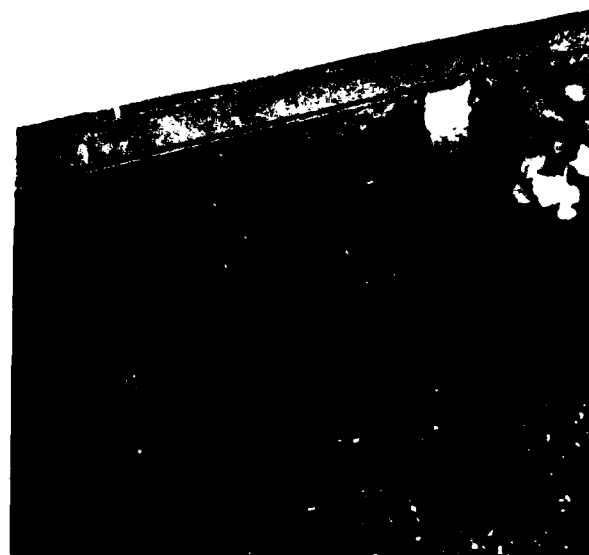

DV6 Debris and Vegetation
 (Medium Severity)
 Vegetation growing on roof

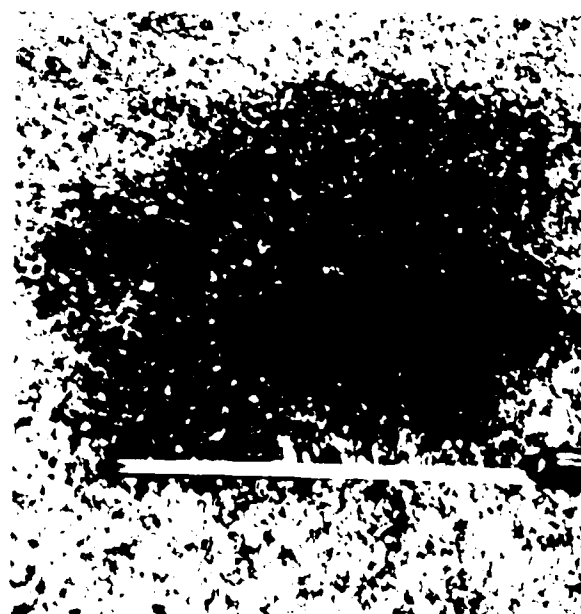

IMPROPER EQUIPMENT SUPPORTS

Description: Pipe, conduit, and mechanical equipment supports (wood sleepers, channels, etc.) which are placed directly on the roof surface with no protective pad or placed at insufficient height to allow for maintaining the membrane below the equipment. Repairing this distress may require replacing the surrounding insulation and membrane.

Note: Terminations for guy wires are to be rated as flashed penetrations distresses.

Severity Levels:

Low:

1. All improper equipment supports are rated low severity as a minimum due to the maintenance problems associated with them.

Medium: Either of the following conditions:

1. Movement of the support has caused displacement of the roof surfacing but has not damaged the membrane.
2. The equipment is bolted through the membrane but the bolts appear to be sealed.

High: Either of the following conditions:

1. The support has caused damage to the roof membrane.
2. The equipment is bolted through the membrane and the bolts appear not to be sealed.

Measurement: Measure square feet of each improper equipment support. The minimum dimension for length and width of a support shall be 1 ft.

Density:


$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where A = total area of improper equipment supports (sq ft)
B = total area of roof section being rated (sq ft)


Note: The problem density is calculated for each existing severity level.




EQ1 Improper Equipment Supports
 <Low Severity>
 Pipe supported by wood block

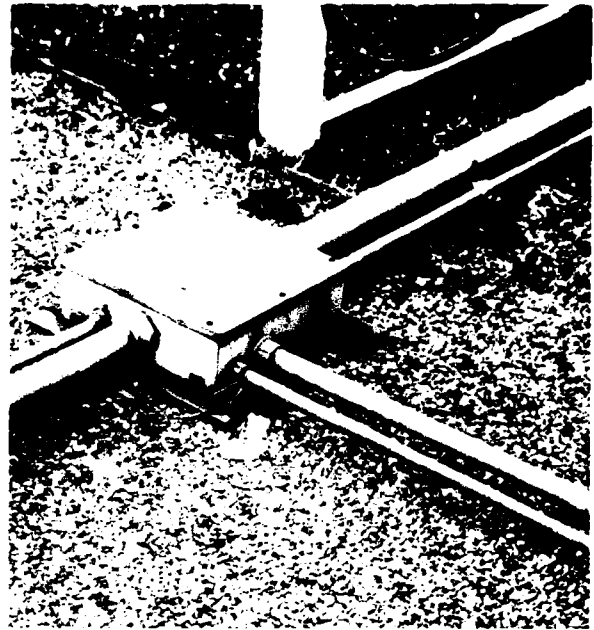

EQ2 Improper Equipment Supports
 <Low Severity>
 Conduit supported by wood blocks

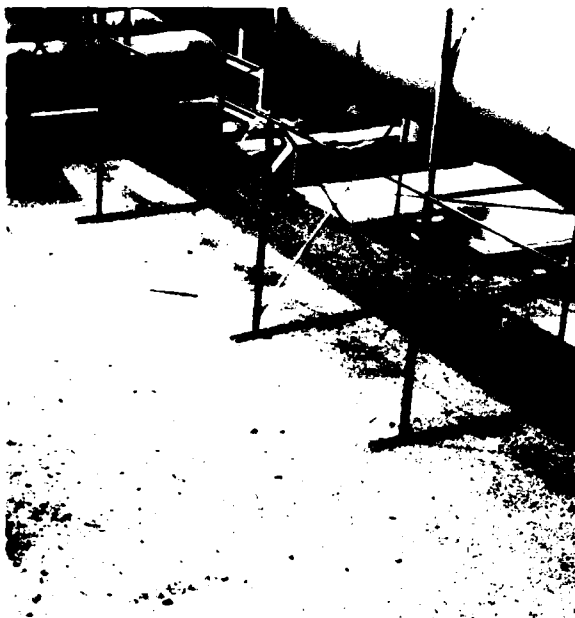


EQ3 Improper Equipment Supports
 <Low Severity>
 Ductwork supported on steel channels
 which rest on the membrane, unflashed

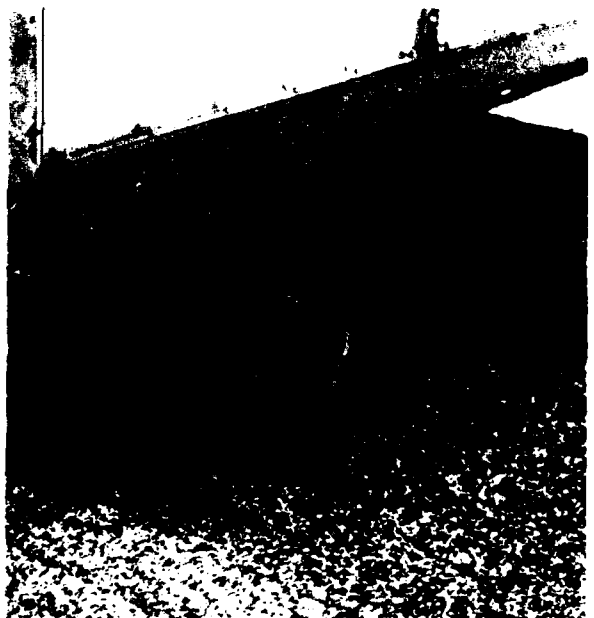

EQ4 Improper Equipment Supports
 <Low Severity>
 Large air-conditioning unit
 supported on unflashed steel


Improper Equipment Supports (EQ)

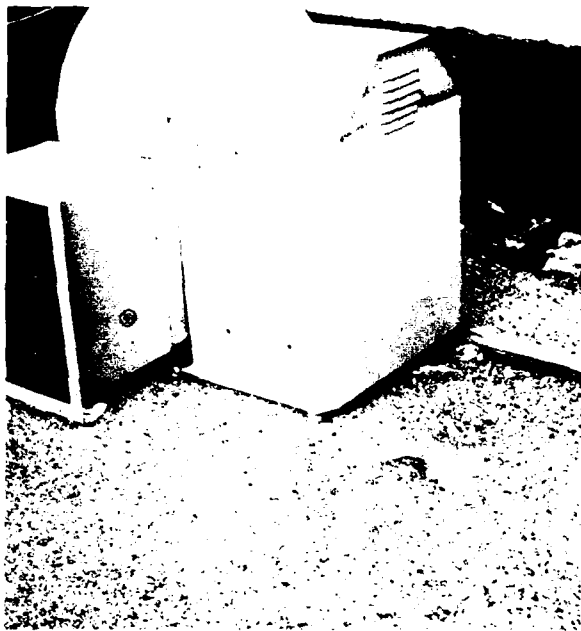

EQ5 Improper Equipment Supports
 <Medium Severity>
 Air handling equipment installed
 directly on the roof surface



EQ6 Improper Equipment Supports
 <High Severity>
 Blocks supporting piping have
 moved, tearing the roof membrane

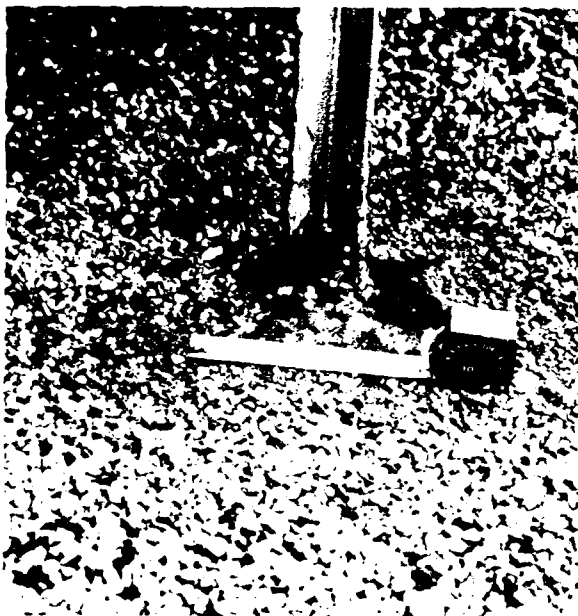


EQ7 Improper Equipment Supports
 <High Severity>
 Angle leg set on roof without
 flashing




EQ8 Improper Equipment Supports
 <High Severity>
 Equipment support has damaged
 membrane



EQ9 Improper Equipment Supports
 <High Severity>
 Improper A/C support and pipe
 penetration

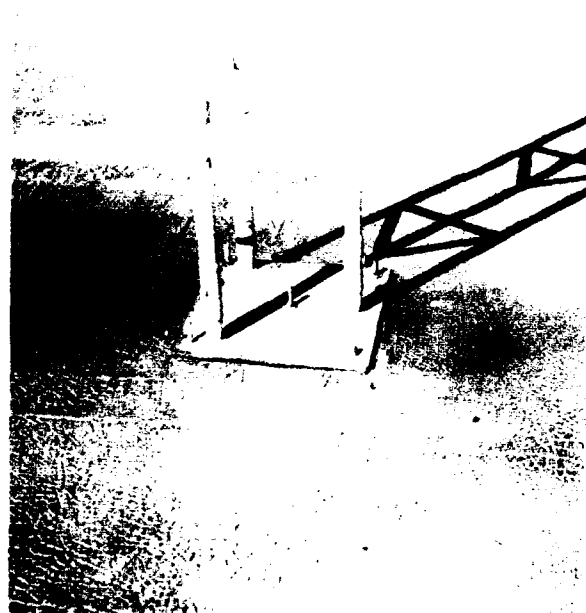

EQ10 Improper Equipment Supports
 <High Severity>
 Base for antenna has not been
 placed on a flashed curb.
 Bolts penetrate membrane

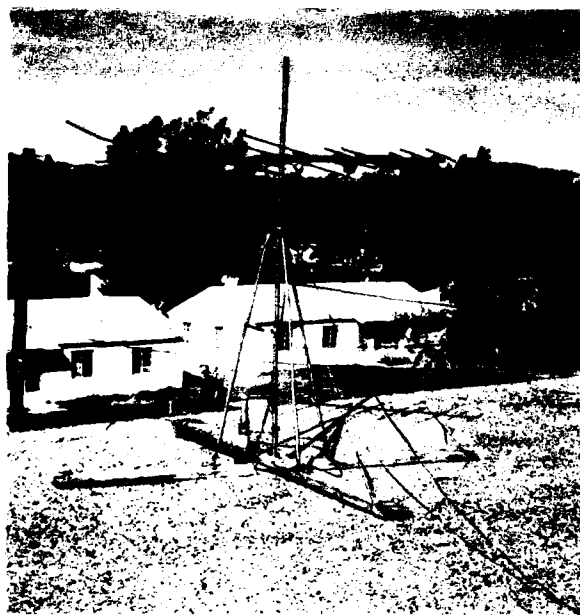

EQ11 Improper Equipment Supports
 <High Severity>
 Antenna base is nailed to roof

PONDING

Description: Standing water is present or there is evidence of ponding by the presence of staining. Water which remains after 48 hr. is considered ponded water.

Severity Levels:

Low:

1. Ponding is rated low severity due to the maintenance problems associated with it.

Measurement: Measure square feet of affected area.

Density:

$$\frac{A}{B} \times 100 = \text{Problem Density}$$

where: A = total area of ponding (sq ft)

B = total area of roof section being rated (sq ft)


Causes:

1. Improper design of roof drainage system.
2. Irregularities of membrane surface.
3. Clogged roof drains and scuppers or obstructions.



PD1 Ponding
<Low Severity>
Ponding is occurring between
drains

Ponding (PD)

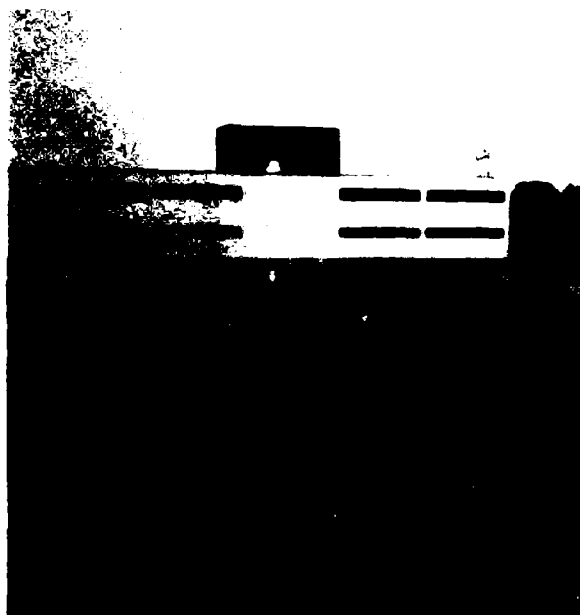

PD2 Ponding
<Low Severity>
Ponding is occurring at edge of




PD3 Ponding
<Low Severity>
Drain is blocked. Clearing of drain
to the inspector will eliminate the
ponding.



PD4 Ponding
<Low Severity>
Scupper edge is too high and
blocks drainage



PD5 Ponding
<Low Severity>
Ponding on roof

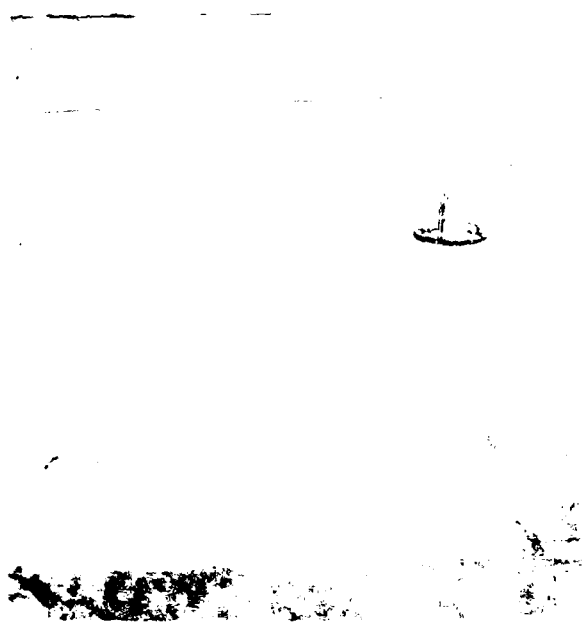

PD6 Ponding
<Low Severity>
Dist. accumulation on roof
indicating that water ponds
in this area



PD7 Ponding
 <Low Severity>
 Debris--indication of ponding





PD8 Ponding
 <Low Severity>
 Drain is placed too high







PD10 Ponding
 <Low Severity>
 Evidence of ponding shown in PD9


APPENDIX A:

DEDUCT VALUE CURVES

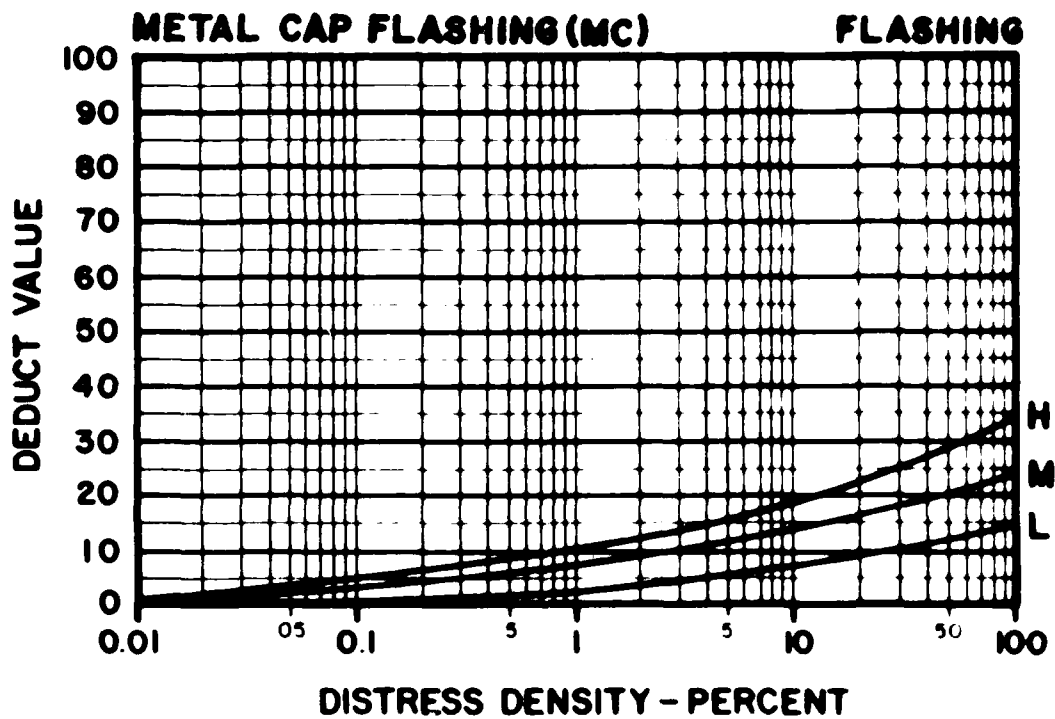
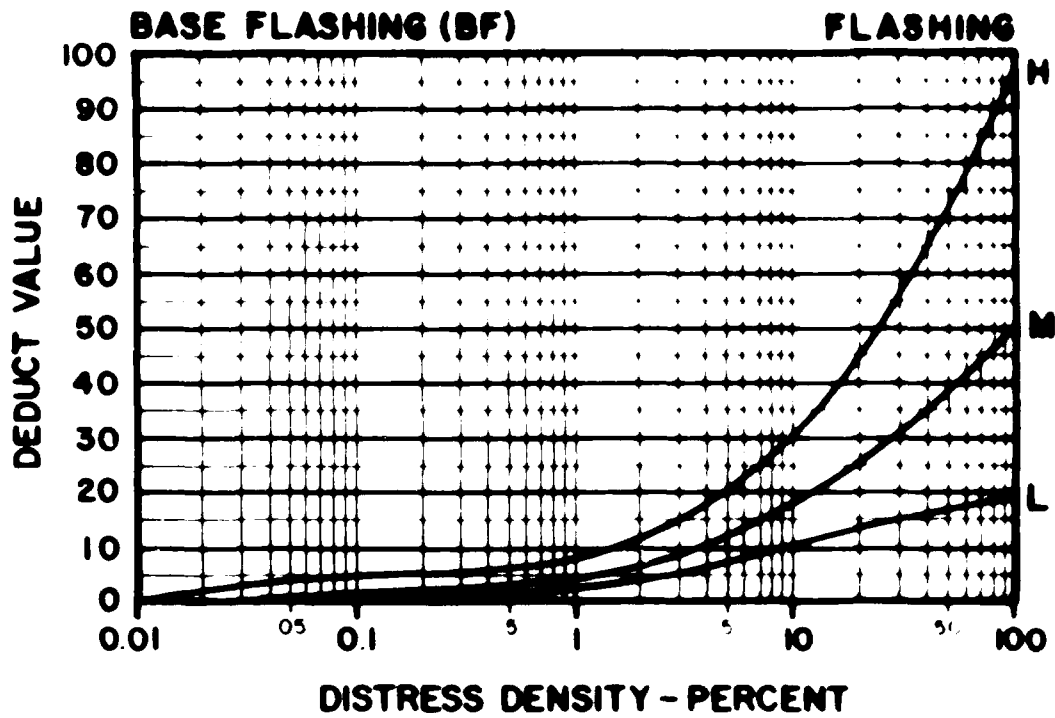


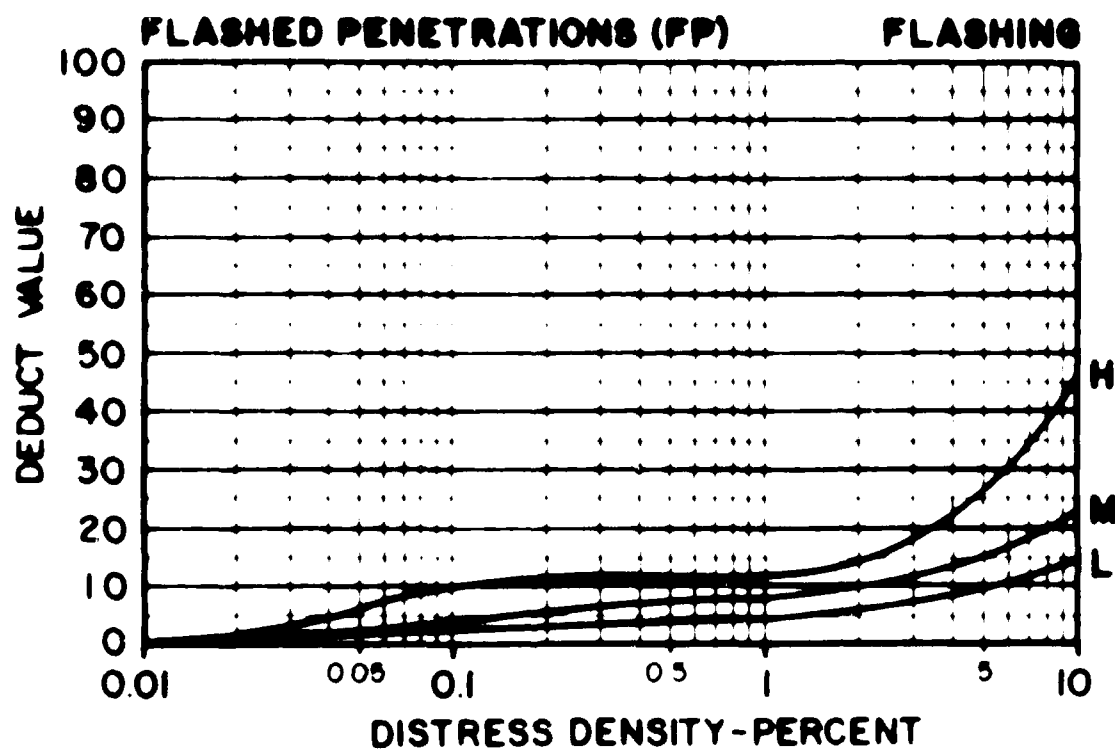
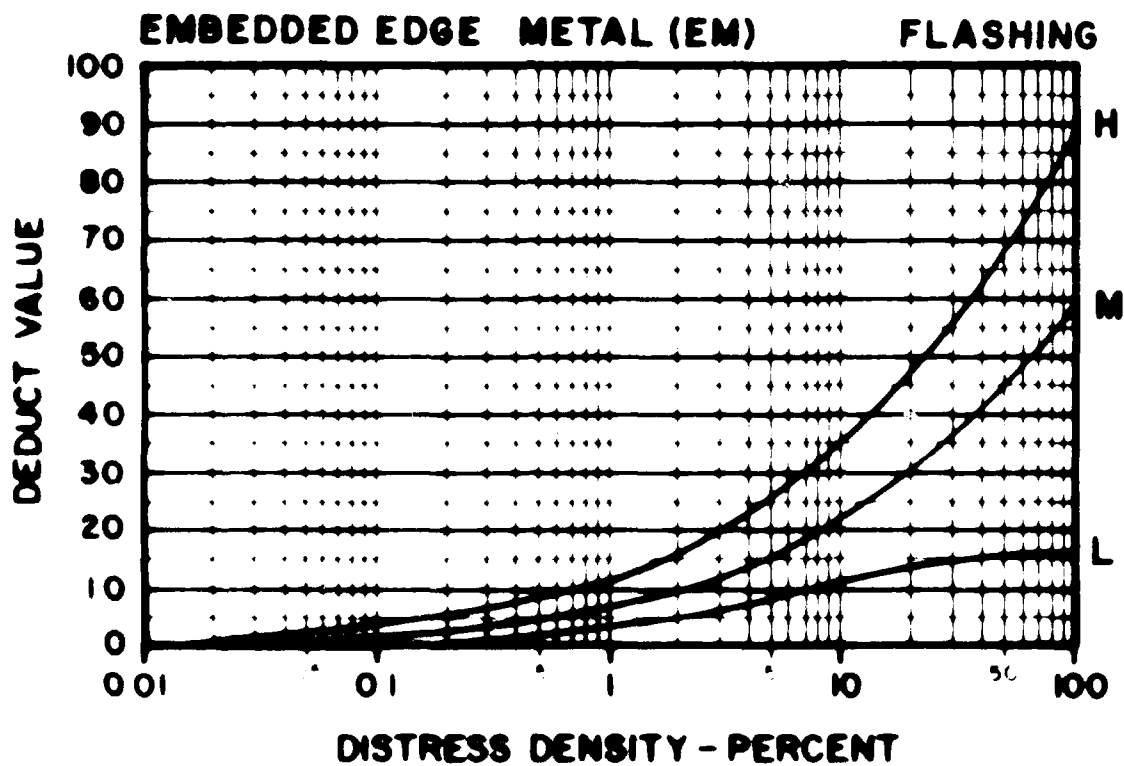


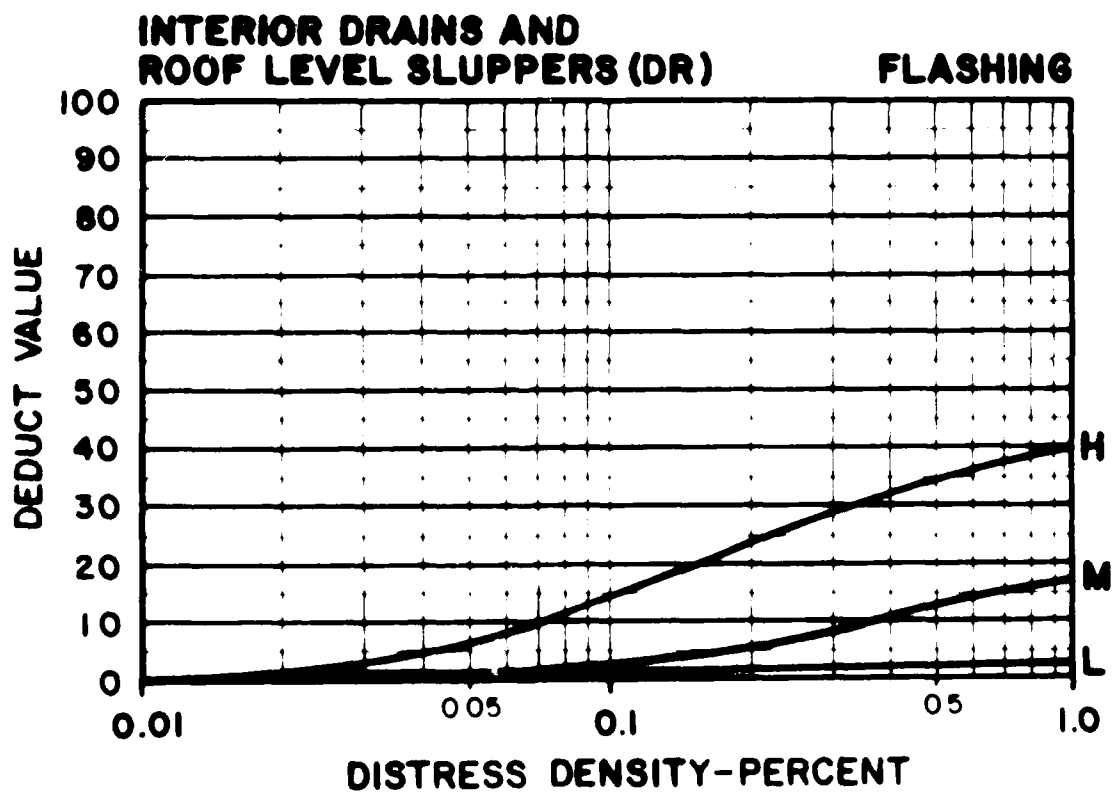
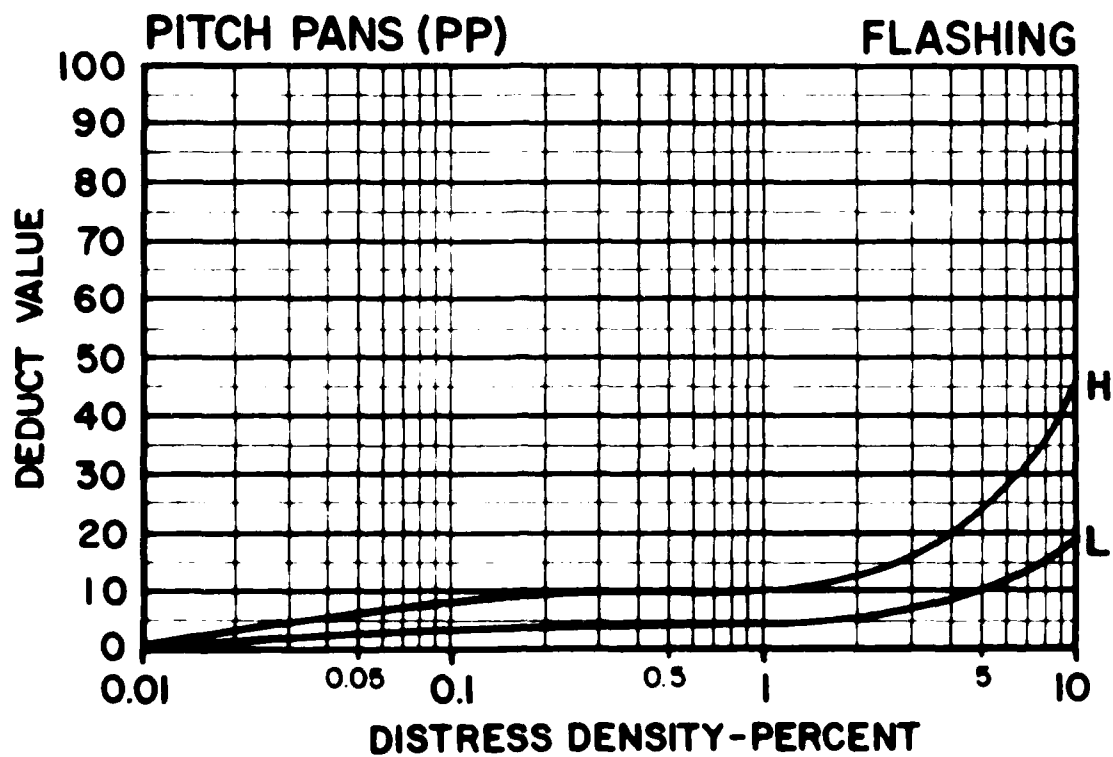



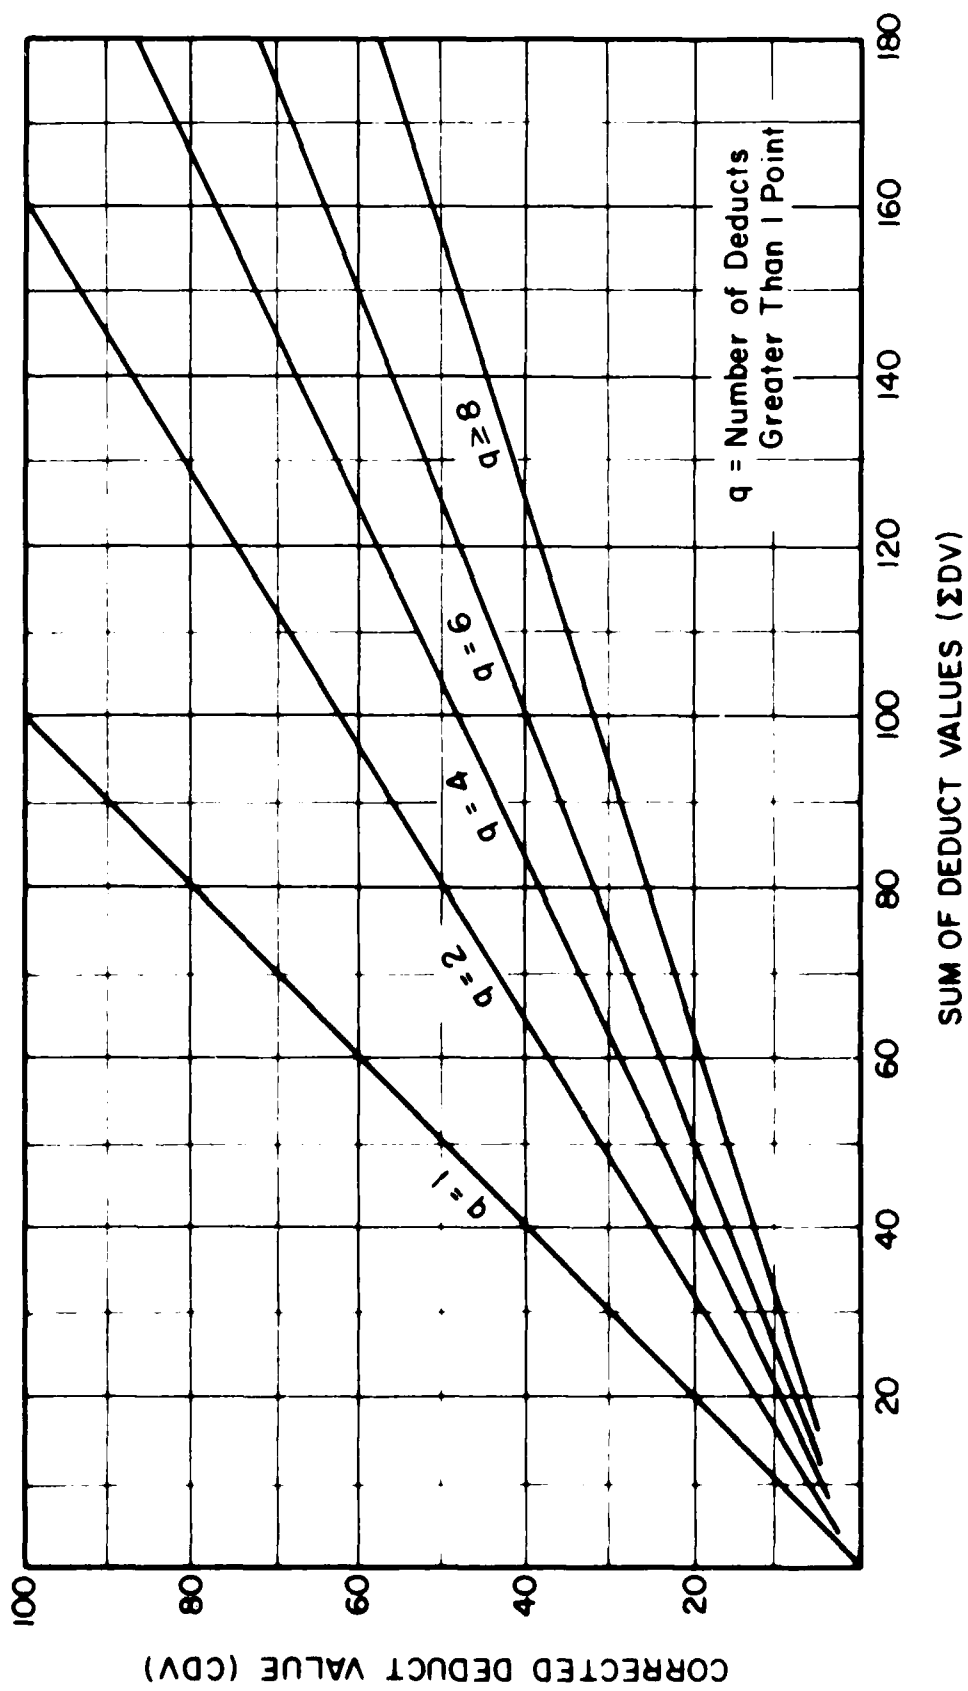




Corrected deduct values for flashing.

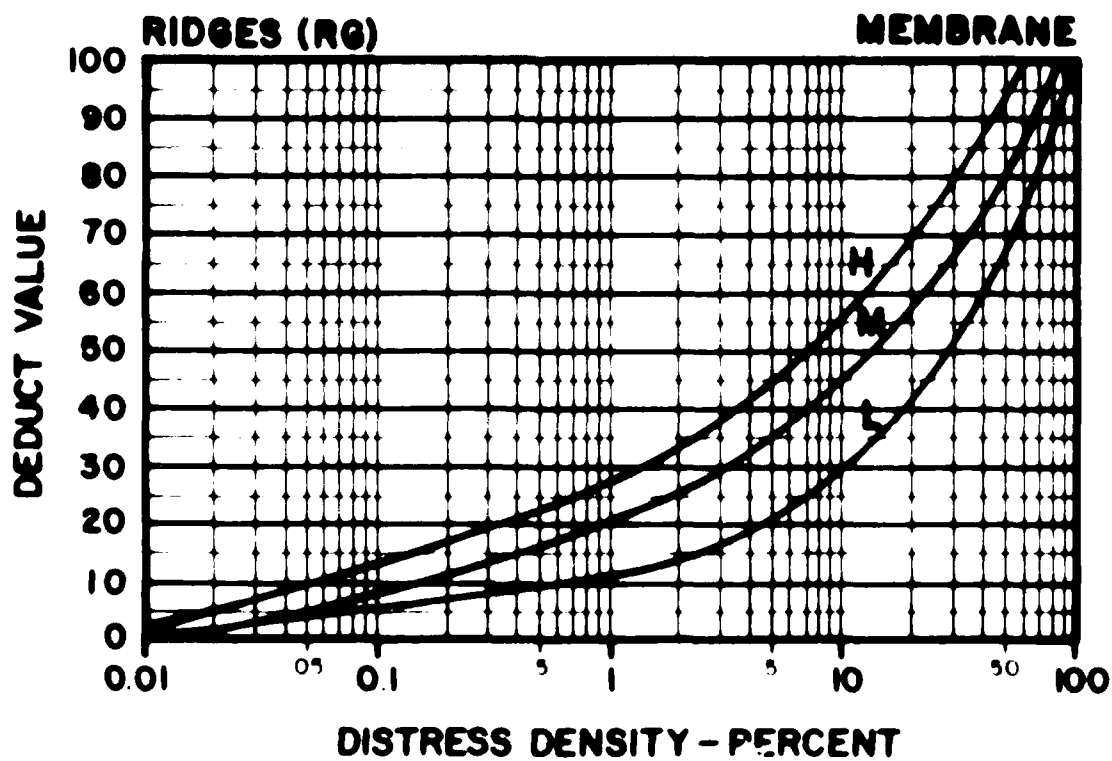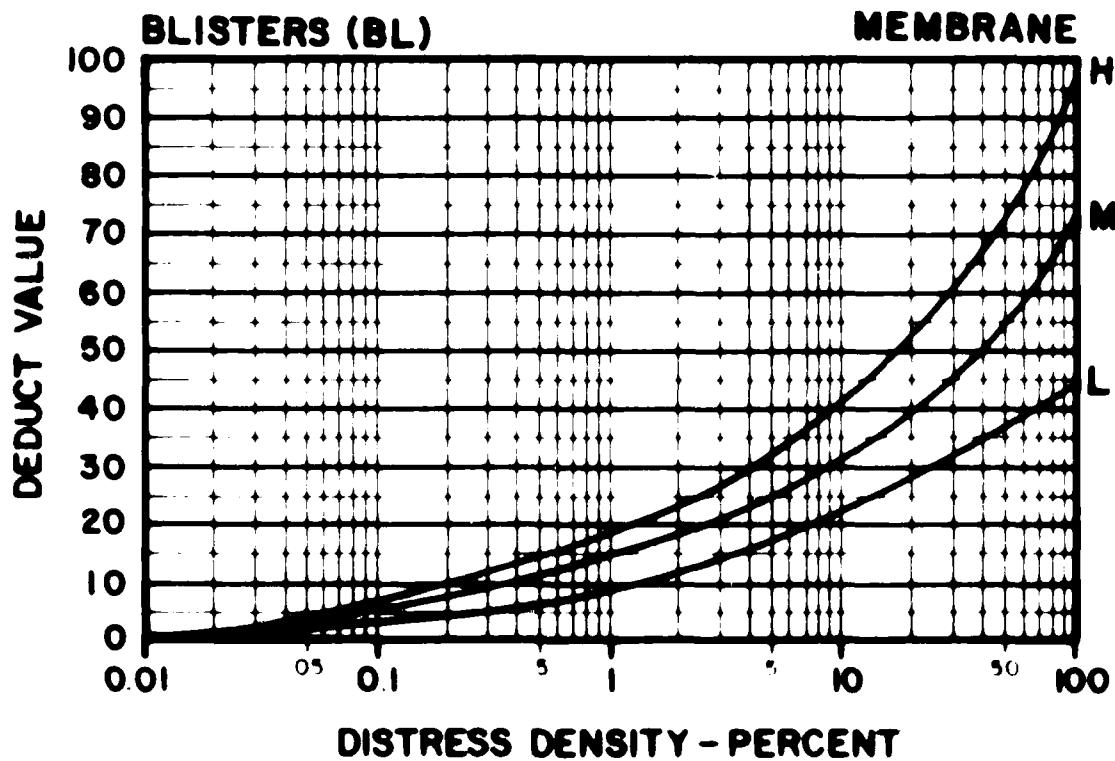


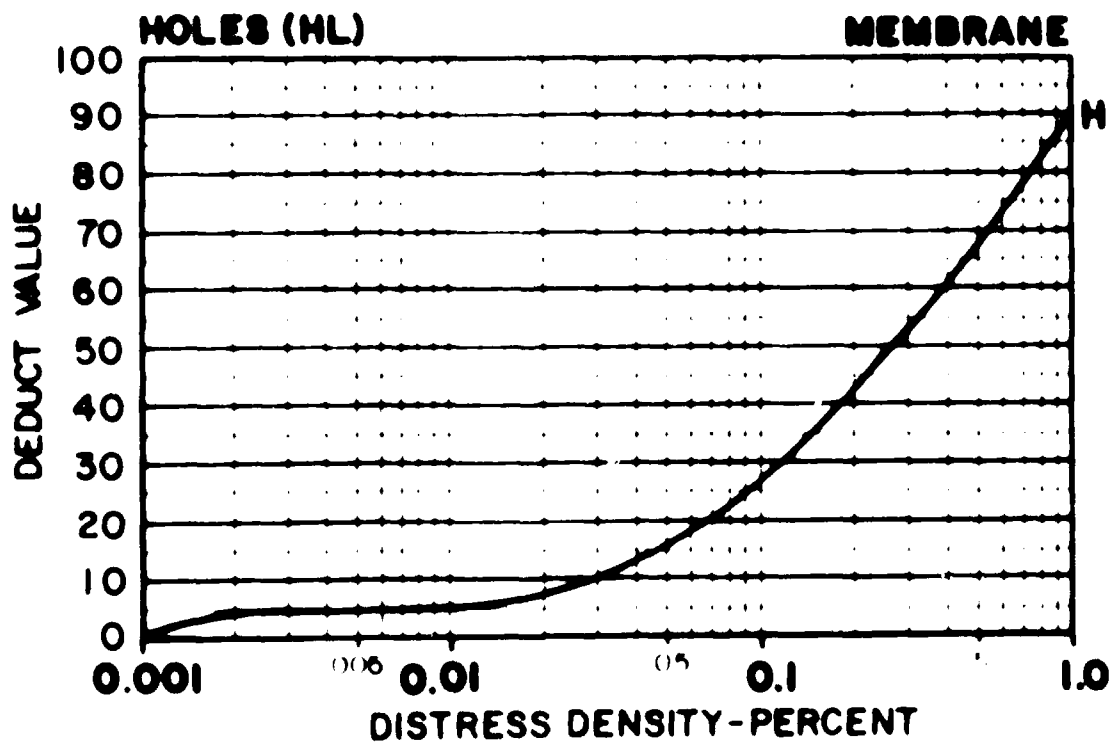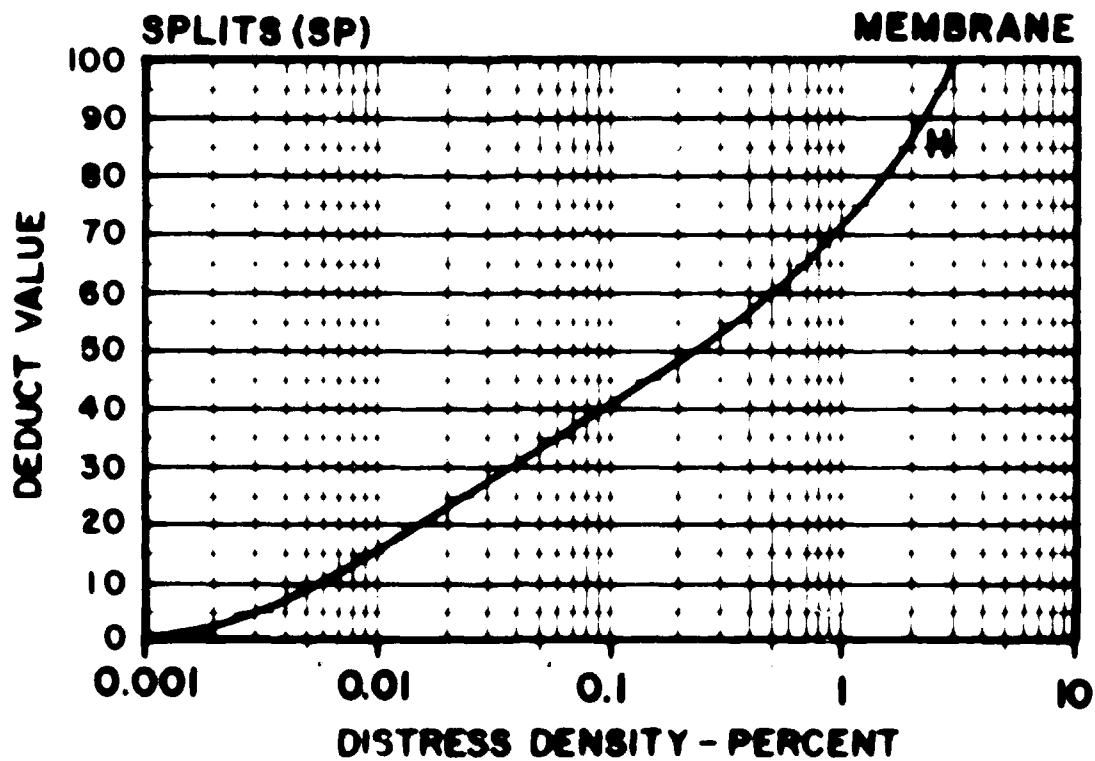

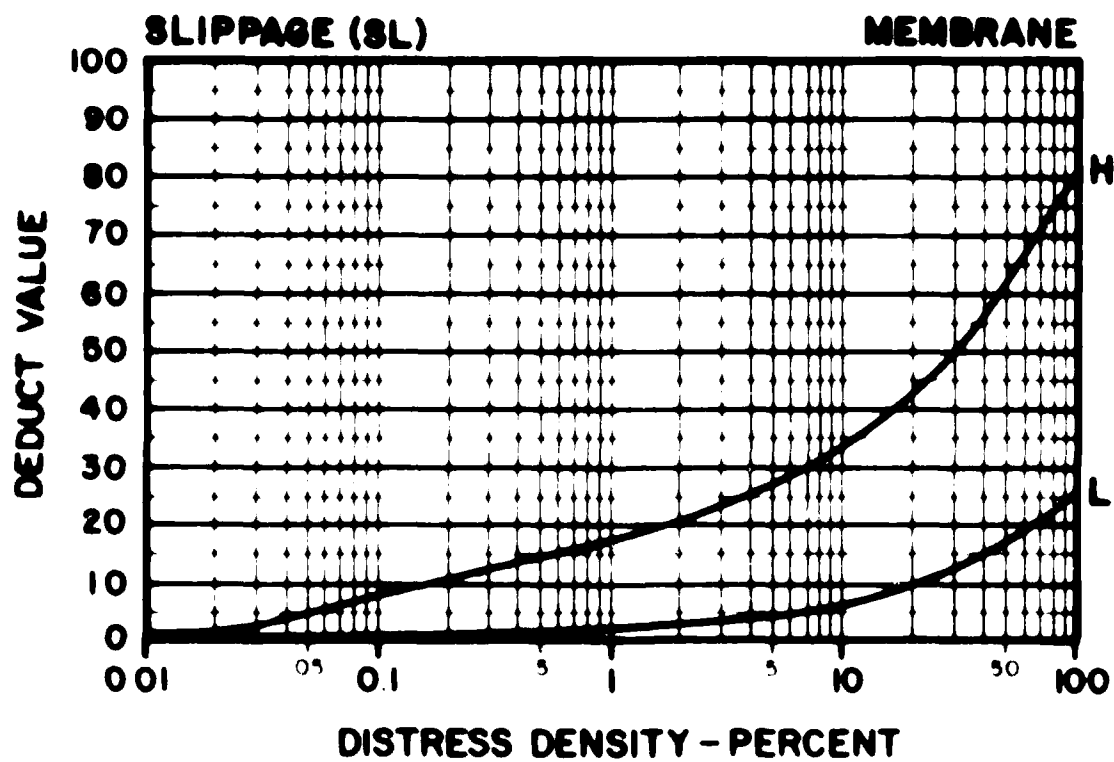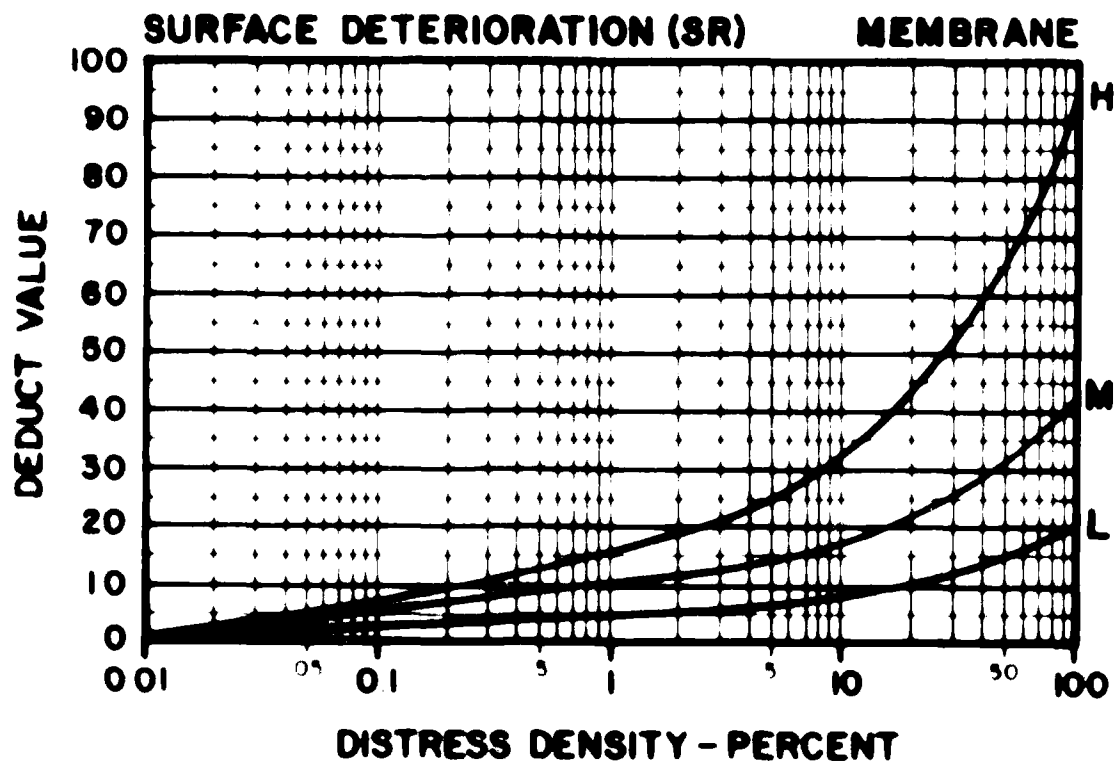

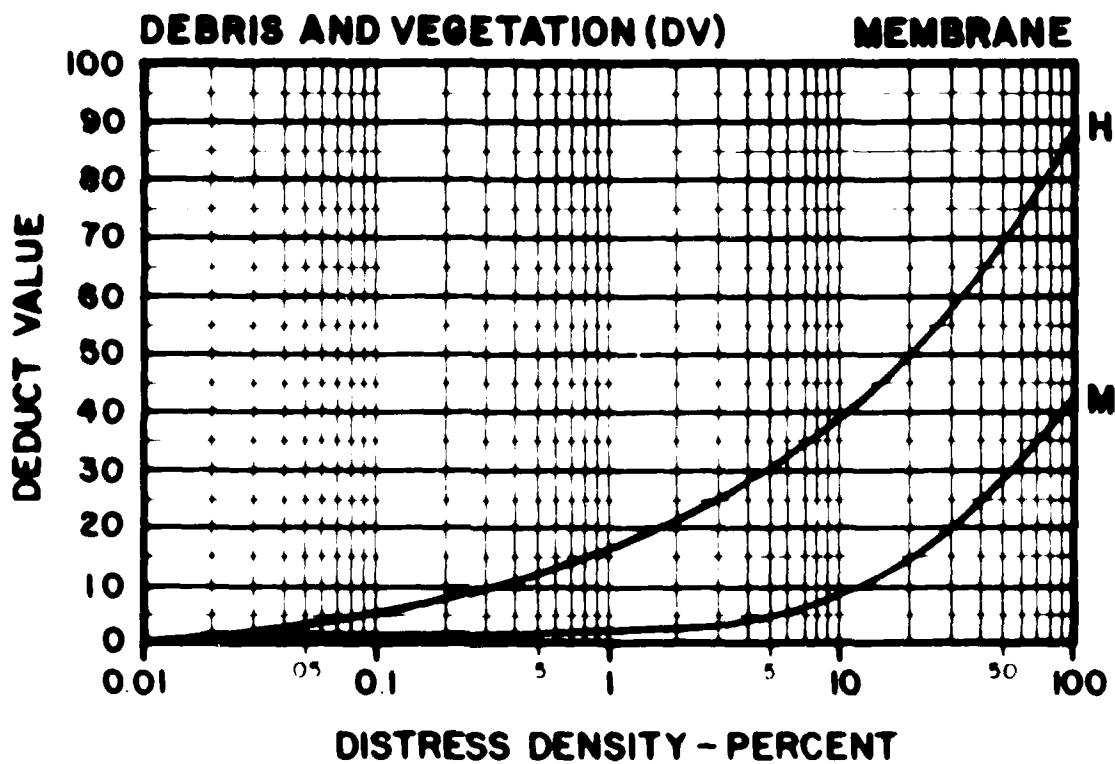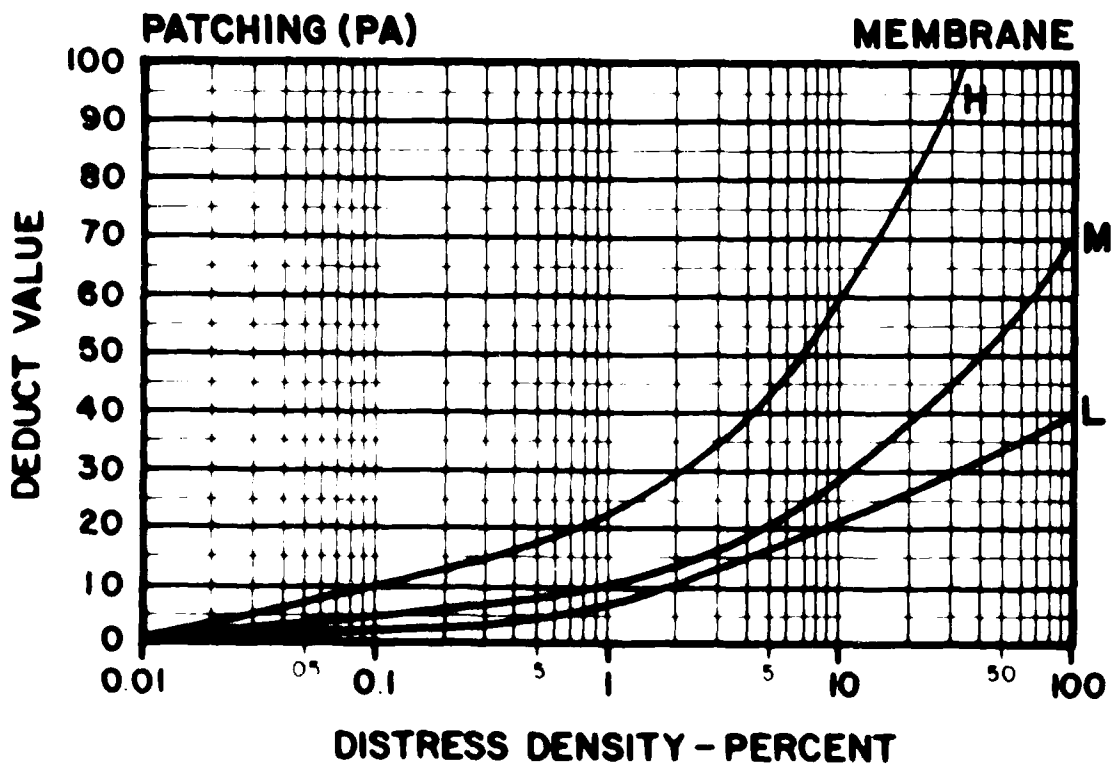

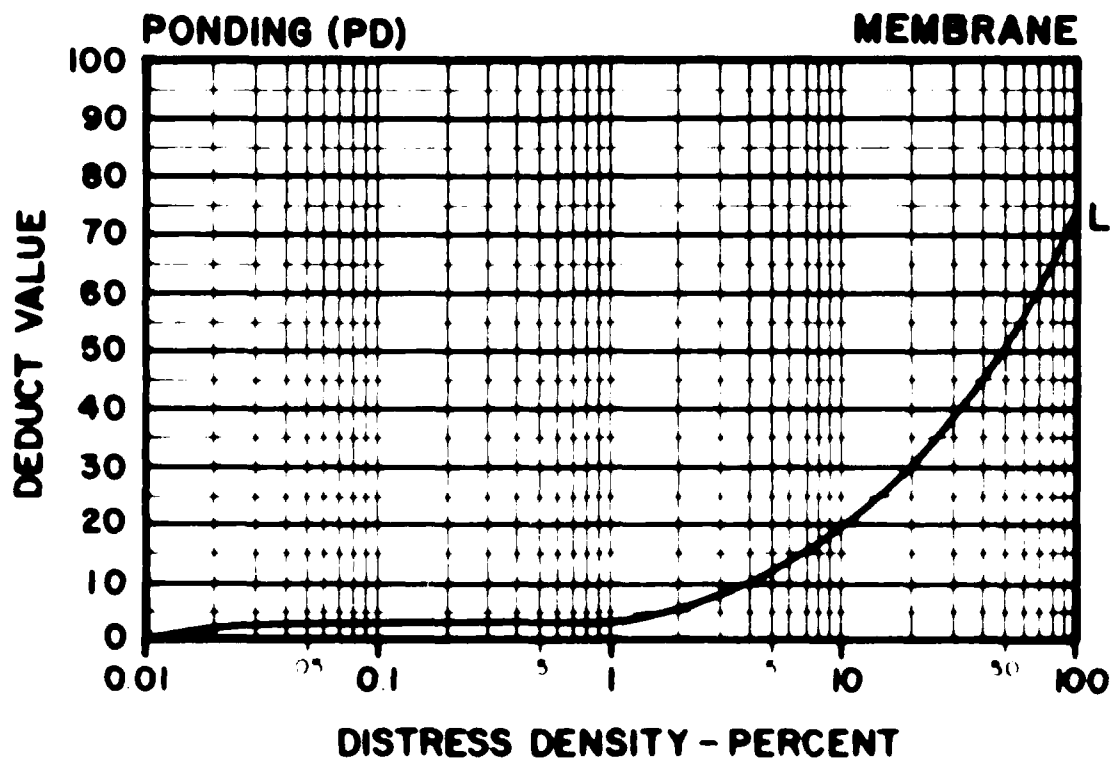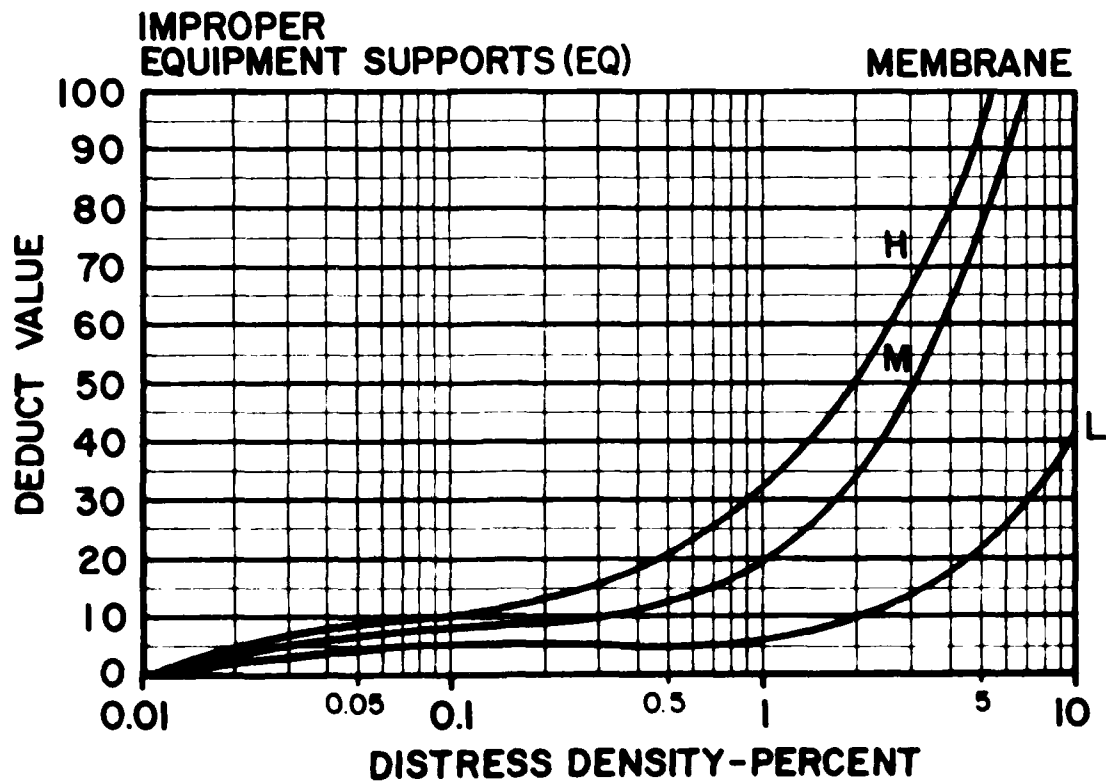

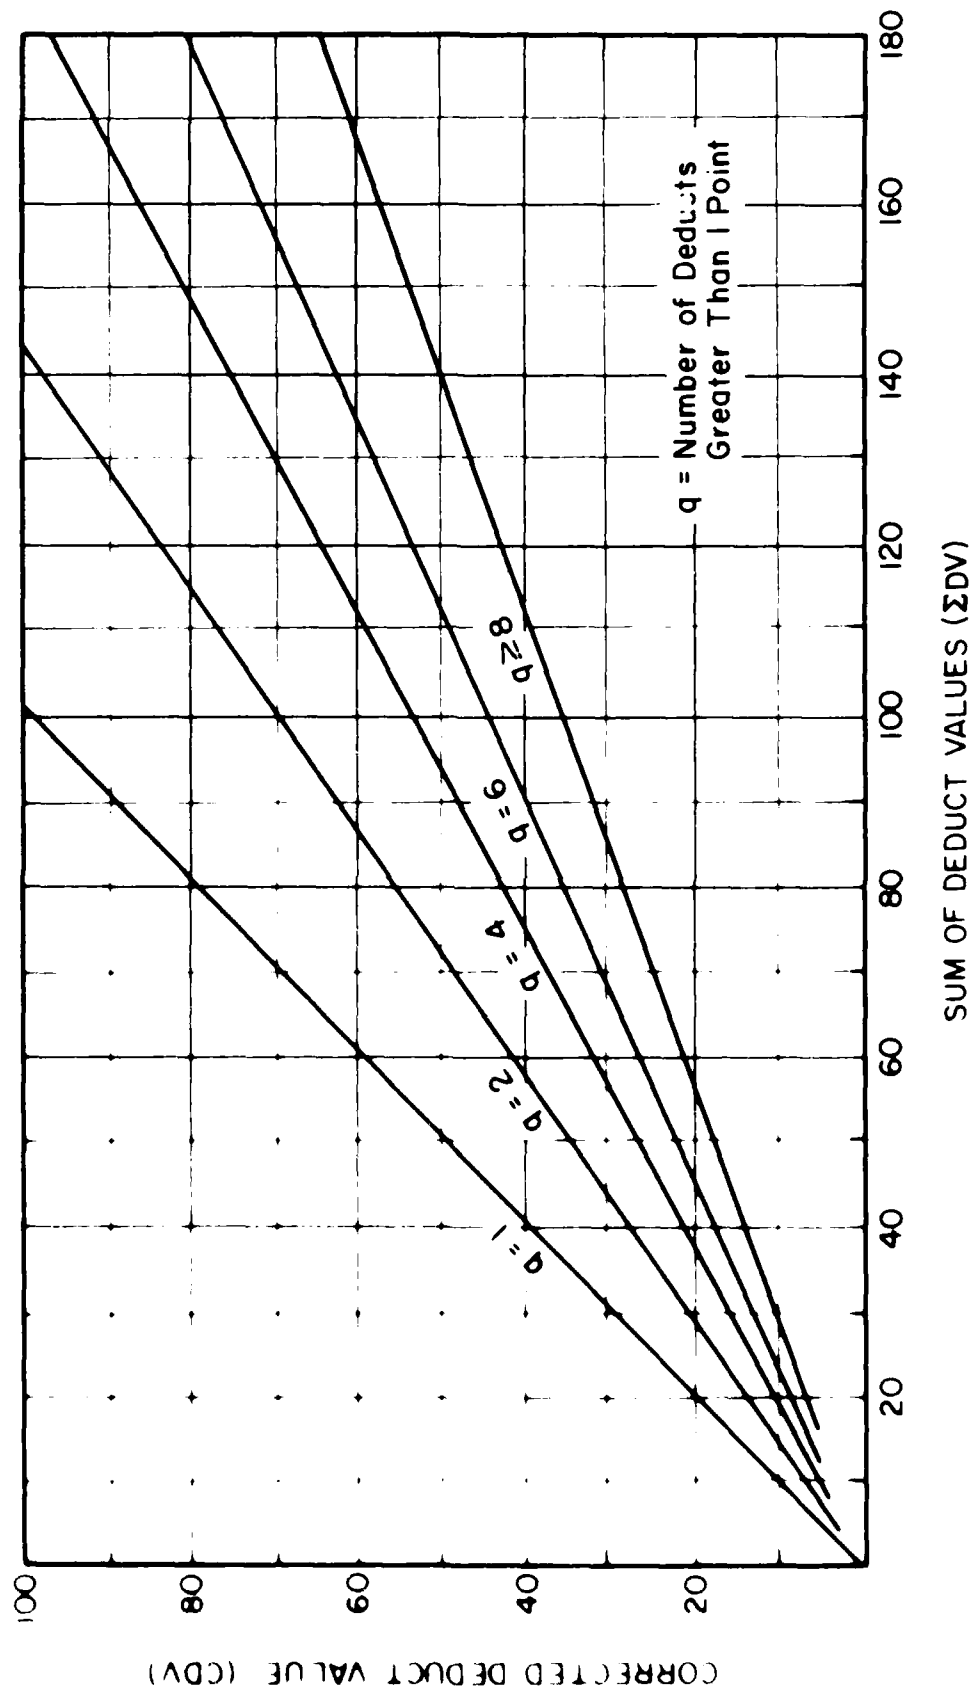

Corrected deduct values for membrane.

APPENDIX B:

INSPECTION AND RATING FORMS

On the following pages are a Roof Inspection Worksheet (front and back) and a Roof Section Rating Form that may be photocopied for use.

ROOF INSPECTION WORKSHEET INSTALLATION

BUILDING _____
 SECTION _____

PER. FLASHING _____ FT
 CURB FLASHING _____ FT

DATE _____
 NAME _____

DISTRESS TYPE		
BF - BASE FLASH	BL - BLISTERS	SL - SLIPPAGE
MC - METAL CAP	RG - RIDGES	PA - PATCHING
EM - EMBEDDED MET	SP - SPLITS	DV - DEBRIS & VEG
FP - FLASHED PEN	HL - HOLES	EQ - EQ SUPPORTS
PP - PITCH PANS	SR - SURF DET	PD - PONDING
DR - DRAIN & SCUPPER		

I D E N T I F I C A T I O N	D I S T R E S S	S E V E R I T Y	Q U A N T I T Y
--	--------------------------------------	--------------------------------------	--------------------------------------

SCALE

NORTH

REMARKS:

AD-A190 368

MEMBRANE AND FLASHING CONDITION INDEXES FOR BUILT-UP
ROOFS VOLUME 2 INSPE (U) CONSTRUCTION ENGINEERING
RESEARCH LAB (ARMY) CHAMPAIGN IL M Y SHAHIN ET AL

2/2


UNCLASSIFIED

SEP 87 CERL-TR-M-87/13-VOL-2

F/G 13/13

NL



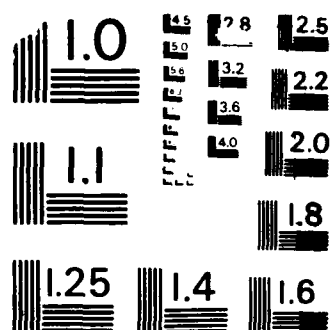

MICROCOPY RESOLUTION TEST CHART
NATIONAL BUREAU OF STANDARDS-1963-A

[illegible]

USA-CERL DISTRIBUTION

Chief of Engineers
ATTN: Tech Monitor
ATTN: CEIM-SL (2)
ATTN: CECC-P
ATTN: CECW
ATTN: CECW-0
ATTN: CECW-P
ATTN: CEEC
ATTN: CEEC-C
ATTN: CEEC-E
ATTN: CERD
ATTN: CERD-C
ATTN: CERD-M
ATTN: CERM
ATTN: DAEN-ZCE
ATTN: DAEN-ZCF
ATTN: DAEN-ZCI
ATTN: DAEN-ZCM
ATTN: DAEN-ZCZ

FESA, ATTN: Library 22060
ATTN: DET III 79906

US Army Engineer Districts
ATTN: Library (41)

US Army Engineer Divisions
ATTN: Library (14)

US Army Europe
AEAEN-ODCS/Engr 09403
ISAE 09081

V Corps
ATTN: DEH (11)

VII Corps
ATTN: DEH (15)

21st Support Command
ATTN: DEH (12)

USA Berlin
ATTN: DEH (11)

USASETAF
ATTN: DEH (10)

Allied Command Europe (ACE)
ATTN: DEH (3)

8th USA, Korea (19)

ROK/US Combined Forces Command 96301
ATTN: EUSA-HHC-CFC/Engr

USA Japan (USARJ)
ATTN: AJEN-DEH 96343
ATTN: DEH-Honshu 96343
ATTN: DEH-Okinawa 96331

416th Engineer Command 60623
ATTN: Facilities Engineer

US Military Academy 10966
ATTN: Facilities Engineer
ATTN: Dept of Geography &
Computer Science
ATTN: DSCPER/MAEN-A

AMMRC, ATTN DRXMR-WE 02172

USA AMCCOM 61299-6000
ATTN: AMSMC-RI
ATTN: AMSMC-IS

AMC - Dir., Inst., & Serve
ATTN: DEH (23)
ATTN: AMCEN-A

DLA ATTN: DLA-WI 22314

DNA ATTN: NADS 20305

FORSCOM
FORSCOM Engr, ATTN: AFEN-DEH
ATTN: DEH (23)

HSC
ATTN: HSLO-F 78234
ATTN: Facilities Engineer
Fitzsimons AMC 80240
Walter Reed AMC 20012

TRADOC
HQ, TRADOC, ATTN: ATEN-DEH
ATTN: DEH (19)

TSARCOM, ATTN: STSAS-F 53120

USACC, ATTN: Facilities Engr (2)

WESTCOM
ATTN: DEH, Ft. Shafter 96858
ATTN: APEN-IM

SHAPE 09055
ATTN: Surv. Section, CCB-OPS
Infrastructure Branch, LANDA

HQ USEUCOM 09128
ATTN: ECJ 4/7-LOE

FORT BELVOIR, VA 22060 (7)
ATTN: Canadian Liaison Officer
ATTN: British Liaison Officer
ATTN: Australian Liaison Officer
ATTN: French Liaison Officer
ATTN: German Liaison Officer
ATTN: Water Resources Support Ctr
ATTN: Engr Studies Center
ATTN: Engr Topographic Lab.
ATTN: ATZA-DTE-SU
ATTN: ATZA-DTE-EM
ATTN: R&D Command

CRREL, ATTN: Library 03755

WES, ATTN: Library 39180

HQ, XVIII Airborne Corps
and Fort Bragg
ATTN: AFZA-FE-EE 28307

Area Engineer, AEDC-Area Office
Arnold Air Force Station, TN 37389

Chanute AFB, IL 61868
3345 CES/DE, Stop 27

Norton AFB, CA 92409
ATTN: AFRCE-MX/DEE

AFESC, Tyndall AFB, FL 32403

NAVFAC
ATTN: Engineering Command (7)
ATTN: Division Offices (6)
ATTN: Naval Public Works Center (9)
ATTN: Naval Civil Engr Lab. (3)

NCEL
ATTN: Library, Code L08A 93043

Defense Technical Info. Center 22314
ATTN: DDA (2)

SETAF Engineer Design Office 09019

Engr Societies Library, NY 10017

Natl Guard Bureau Instl. Div 20310

US Govt Print Office 22304
Receiving Sect/Depository Copies (2)

US Army Env. Hygiene Agency
ATTN: HSHB-E 21010

National Bureau of Standards 20899

310
06/87

EMC Team Distribution

Chief of Engineers 20314
ATTN: DAEN-ZCF-B
ATTN: DAEN-ECZ-A
ATTN: DAEN-ECB (2)
ATTN: DAEN-ZCP

US Army Engineer District
New York 10007
ATTN: Chief, Design Br
Pittsburgh 15222
ATTN: Chief, ORPCD
ATTN: Chief, Engr Div
Philadelphia 19106
ATTN: Chief, NAPEN-D
Baltimore 21203
ATTN: Chief, Engr Div
Norfolk 23510
ATTN: Chief, NAOEN-M
ATTN: Chief, NAOEN-D
Huntington 25721
ATTN: Chief, ORHED-F
Wilmington 28401
ATTN: Chief, SAWCO-C
ATTN: Chief, SAWEN-D
Charleston 29402
ATTN: Chief, Engr Div
Savannah 31402
ATTN: Chief, SASAS-L
Jacksonville 32232
ATTN: Const Div
Mobile 36628
ATTN: Chief, SAMEN-D
ATTN: Chief, SAMEN-F
ATTN: Chief, SAMEN
Nashville 37202
ATTN: Chief, ORNED-F
Memphis 38103
ATTN: Chief, Const Div
ATTN: Chief, LMMED-D
Vicksburg 39180
ATTN: Chief, Engr Div
Louisville 40201
ATTN: Chief, Engr Div
Detroit 48231
ATTN: Chief, NCEED-T
St. Paul 55101
ATTN: Chief, ED-D
ATTN: Chief, ED-F
Rock Island 61201
ATTN: Chief, NCRED-F
St. Louis 63101
ATTN: Chief, ED-D
Kansas City 64106
ATTN: Chief, Engr Div
Omaha 68102
ATTN: Chief, Engr Div
New Orleans 70160
ATTN: Chief, LMNED-DG
Little Rock 42203
ATTN: Chief, Engr Div
Tulsa 74102
ATTN: Chief, Engr Div
Ft. Worth 76102
ATTN: Chief, SWFED-D
Galveston 77550
ATTN: Chief, SWGAS-L
ATTN: Chief, SWGCO-C
ATTN: Chief, SWGED-DC
Albuquerque 87103
ATTN: Chief, Engr Div
Los Angeles 90053
ATTN: Chief, SPLED-F
San Francisco 94105
ATTN: Chief, Engr Div
Sacramento 95814
ATTN: Chief, SPKED-D
ATTN: Chief, SPKCO-C
Far East 96301
ATTN: Chief, Engr Div
Portland 97208
ATTN: Chief, DB-6
ATTN: Chief, FM-1
ATTN: Chief, FM-2

Seattle 98124
ATTN: Chief, NPSCO
ATTN: Chief, NPSEN-FM
ATTN: Chief, EN-DB-ST
Walla Walla 99382
ATTN: Chief, Engr Div
Alaska 99501
ATTN: Chief, NPASA-R

US Army Engineer Division
New England 02154
ATTN: Chief, NEDED-T
ATTN: Laboratory
ATTN: Chief, NEDCD
Middle East (Rear) 22601
ATTN: Chief, MEDED-T

North Atlantic 10007
ATTN: Chief, NADEN
South Atlantic 30303
ATTN: Laboratory
ATTN: Chief, SADEN-TC
ATTN: Chief, SADEN-TS

Huntsville 35807
ATTN: Chief, HNDED-CS
ATTN: Chief, HNDED-M
ATTN: Chief, HNDED-SR
Lower Mississippi 39180
ATTN: Chief, LMVED-G
Ohio River 45201
ATTN: Laboratory
ATTN: Chief, Engr Div
Missouri River 68101
ATTN: Chief, MRDED-G
ATTN: Laboratory
Southwestern 75202
ATTN: Laboratory
ATTN: Chief, SWDED-MA
ATTN: Chief, SWDED-TG
South Pacific 94111
ATTN: Laboratory
Pacific Ocean 96858
ATTN: Chief, Engr Div
ATTN: FM&S Branch
ATTN: Chief, PODED-D
North Pacific 97208
ATTN: Laboratory
ATTN: Chief, Engr Div

6th US Army 94129
ATTN: AFKC-EN

7th US Army 09407
ATTN: AETTM-HRD-EHD

HQ, Combined Field Army (ROK/US) 96358
ATTN: CFAR-EN

US Army Foreign Science and
Tech Center
ATTN: Charlottesville, VA 22901
ATTN: Far East Office 96328

USA ARRADCOM 07801
ATTN: DRDAR-LCA-OK

HQ, USAMRDC
ATTN: SGRD-PLC
Fort Detrick, MD 21701

West Point, NY 10996
ATTN: Dept of Mechanics
ATTN: Library

Ft. Belvoir, VA 22060
ATTN: Learning Resource Center

Ft. Benning, GA 31905
ATTN: ATZB-FE-EP
ATTN: ATZB-FE-BG

Ft. Leavenworth, KS 66027
ATTN: ATZLCA-SA

Ft. Lee, VA 23801
ATTN: DRXMC-D (2)

Ft. McPherson, GA 30330
ATTN: AFEN-CD

Ft. Monroe, VA 23651
ATTN: ATEN-AD (3)
ATTN: ATEN-FE-ME
ATTN: ATEN-FE-BG (2)

Ft. Richardson, AK 99505
ATTN: AFZT-FE-E

Rocky Mountain Arsenal 80022
ATTN: SARRM-CO-FEP

USA-WES 39180
ATTN: C/Structures
ATTN: Soils & Pavements Lab

Naval Facilities Engr Command 22332
ATTN: CODE 2013 C

COMMANDER (CODE 2636) 93555
Naval Weapons Center

Little Rock AFB
ATTN: 314/DEEE

Bldg. Research Advisory Board 20418

Dept of Transportation Library 20590
Transportation Research Board 20418

112
+1
3/87

Tyndall AFB 32403
ATTN: HQ AFESC/DEMM (3)

FESA 22060
ATTN: CEFES-EB (3)

CRREL 07355
ATTN: CECRL-EC (3)

NAVFACENGCOM 19112
ATTN: Code 102A (750)

END

DATE

FILMED

DTIC

4/88